Vehicle drops at front axle on one or both sides.

Topic number Ll32.22-P-058343

Version 1

Design group 32.22 Air suspension

Date 02-25-2014

Validity MODEL 222 with AIRMATIC (code 489)

Reason for change

Complaint:

The vehicle drops at the front axle on one or both sides by more than 2 cm overnight.

Cause:

Leakage in area of cover on top of air suspension strut.

Attachments	
File	Designation
1.jpg	Figure 1

Remedy:

Check suspension strut for leaks in area of strut cover using leak detector spray or soapy water. (Figure 1)

If leaking, replace air suspension strut.

Symptoms
Chassis/suspension / Suspension/Dampening / Suspension System Function / Vehicle level too low
Chassis/suspension / Suspension characteristic / Lopsided/crooked
Chassis/suspension / Suspension/Dampening / AIRMATIC / AIRMATIC leaks / Air leakage
Chassis/suspension / Suspension/Dampening / AIRMATIC / AIRMATIC display / Air Suspension- Stop, Vehicle Too Low
Changis/ayanangian / Syanangian/Dampaning / AIDMATIC / AIDMATIC function / Valida is langided

Chassis/suspension / Suspension/Dampening / AIRMATIC / AIRMATIC function / Vehicle is lopsided
Chassis/suspension / Suspension/Dampening / AIRMATIC / AIRMATIC function / Vehicle is too low

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 222 320 49 13			Left air suspension strut	1	As required	Х	
A 222 320 50 13			Right air suspension strut	1	As required	Х	

XENTRY

Work units						
Op. no.	Operation text	Time	Damage code	Note		
32-8562	REPLACE LEFT FRONT SUSPENSION STRUT FOR AIR SUSPENSION (AIR- MATIC)		32F0A 04	As required		
32-8562	REPLACE RIGHT FRONT SUSPEN- SION STRUT FOR AIR SUSPENSION (AIRMATIC)		32U0A 04	As required		
32-8070	REPLACE FRONT SUSPENSION STRUTS (BOTH) FOR AIR SUSPENSI- ON (AIRMATIC)		32505 04	As required		

WIS-References				
Document number	Title	Note	Allocation	
AR32.25-P-1017LFB	Remove/install front suspension strut		Cause	