

## Creaking noise in transition area between instrument panel and center console on model series 222 / 217

Topic number	LI68.20-P-059330
Version	1
Design group	68.20 Center console
Date	07-08-2014
Validity	Model series 222 and 217
Reason for change	

### Complaint:

When on rough roads and with side loads applied to the center console (leg support) cracking noise may occur in the transition between the instrument panel and the center console.

### Cause:

The noise is generated at the clipping point between the chrome molding and the cup holder on the stowage compartment.

### Remedy:

1. Remove trim piece of front center console (AR68.20-P-2101LF).
2. Apply lubricant (A 000 989 36 60) to clipping points (see picture).
3. Install trim piece of front center console (AR68.20-P-2101LF).

Attachments	
File	Description
Unbenannt.JPG	Application points for lubricant

Symptoms
Body / Interior equipment / Instrument panel / Noise

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 000 989 36 60			Lubricant	1		X	

Work units				
Op. no.	Operation text	Time	Damage code	Note

---

			68114 36	
--	--	--	----------	--

WIS-References			
Document number	Title	Note	Allocation
ar68.20-p-2101f	Install trim piece at front of center console		Remedy