

Failure of stereo multifunction camera

Topic number	LI54.00-P-064149
Version	1
Design group	54.00 General
Date	05-24-2016
Validity	Valid for vehicles of BR205, BR253, BR217 and BR222 equipped with a stereo multifunction camera.
Reason for change	New software available.

Complaint:

The following messages may appear on the instrument cluster when driving:

- "Active Lane Keeping Assist Inoperative" (code 238)
- "Adaptive Highbeam Assist Inoperative" (code 608)
- "Adaptive Highbeam Assist Plus Inoperative" (code 628)
- "Traffic Sign Assist Inoperative" (code 513)
- "PRE-SAFE Inoperative. See Owner's Manual" (code 23P)
- "DTR+:Steer Assist Inoperative" (code 266)

The systems stated here are no longer available.

The multifunction camera (stereo) control unit (A40/13) has DTC P180504 stored in it.

Cause:

Software release of multifunction camera (stereo) control unit (A40/13).

Remedy:

Optimized software for the multifunction camera (stereo) (A40/13) is included on Xentry DVD 05/2016 or newer.

Control unit/fault code		
Control unit	Fault code	Fault text
A40/13 - Multifunction camera (stereo) (MFK) (SMPC222) (S (222),S (217),C (205))	P180504	The hardware monitoring function has detected a fault in the control unit. There is an internal fault.

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note

XENTRY TIPS

54-0650	CONNECT/DISCONNECT BATTERY CHARGER		820D3 50	
54-1011	SHORT TEST		820D3 50	
54-0991	SOFTWARE		820D3 50	