

## Malfunction of trunk lid control

Topic number	LI80.20-P-059363
Version	1
Design group	80.20 Central locking system
Date	07-12-2014
Validity	MODEL 222 with code 881
Reason for change	

**Complaint:**

The trunk lid sometimes does not open completely and does not close (completely).

This complaint is accompanied by the following symptoms:

- Illumination of the trunk lid control button (S62/26) fails.
- The ACTUAL value\* of the trunk lid lock main catch switch (A85/5s1) indicates "closed" although the trunk lid is open.
- Knocking against the trunk lid lock (A85/5) causes the light of the trunk lid control button (S62/26) to flicker and the ACTUAL value\* of the trunk lid lock main catch switch (A85/5s1) to jump back and forth between the values "open" and "closed".

\* The ACTUAL value of the trunk lid lock main catch switch (A85/5s1) can be found under the following path in Xentry Diagnostics:

Xentry Diagnostics => Control unit => SAM-H (N10/8) => ACTUAL values => Trunk lid => Trunk lid lock main catch switch

**Cause:**

Under analysis.

**Remedy:**

Replace trunk lid lock

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 231 750 00 85			TRUNK LID LOCK	1	Code: 881/883	X	
A 222 750 01 85			TRUNK LID LOCK	1	Code: 884/881+884/883+884	X	

Work units
------------

Op. no.	Operation text	Time	Damage code	Note
88-8306	REMOVE/INSTALL LOCK FOR TRUNK LID, REPLACE IF NECESSARY		75021 H2	