

Model series 222, noises when sitting down, driver seat backrest with rubberized hair mat, without SA code 432

Topic number	LI91.10-P-060008
Version	1
Design group	91.10 Front seats
Date	10-15-2014
Validity	Vehicles not OK as of 01.02.2014 without SA code 432
Reason for change	Remedy expanded
Reason for block	

Complaint:

Noises from the left and right sides of the backrest when sitting down in the driver seat

Cause:

The rubberized hair mat is too soft in the area of the upper backrest, which means that the padding buckles when the lateral support is loaded, pulling the side bolster of the padding inwards.

Remedy:

Application of felt on side flanks of backrest FaserTec padding:

Cut the felt strips to a length of 260mm and stick them together to obtain a width of 50mm. Make sure they are not wrinkled when stuck together.

1. The felt strip is stuck flush along the side flank following the contour. (pic1)
2. Carefully fold the felt strip inwards. Make sure that the felt strip does not wrinkle. (pic 2)
3. The felt strip must be pressed firmly into the contour. (pic 3)

Some parts may be non-stocking parts for MBUSA, and possibly C66 and not immediately available from DAG. Please be aware and check availability prior to scheduling customer repairs.

Attachments	
File	Description
Pic 1.jpg	Stick on felt strip
Pic 2.jpg	Fold felt strip inwards
Pic 3.jpg	Press felt strip into contour
Pic 4.jpg	The finished backrest padding

Symptoms

Body / Seat / Seat noises / Cracking

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 222 910 17 12			Driver seat backrest padding assy.	0		X

A 222 910 35 12		Driver seat backrest padding assy.	0		X
A 222 910 18 00		Driver seat backrest padding assy.	0		X
A 222 910 18 12		Driver seat backrest padding assy.	0		X
A 222 910 36 12		Driver seat backrest padding assy.	0		X
A 222 910 23 03		Driver seat backrest padding assy.	0		X
A 222 910 01 16		Driver seat backrest padding assy.	0		X
A 222 910 73 11		Driver seat backrest padding assy.	0		X
A 222 910 74 11		Driver seat backrest padding assy.	0		X
A 000 983 17 10		Felt tape	10	Length per side: 260mm x 50mm	X

Work units				
Op. no.	Operation text	Time	Damage code	Note
91-8759	REMOVE/INSTALL COVER WITH PADDING FOR BACKREST ON FRONT PASSENGER SEAT	14AW	91N42 36	
91-8659	REMOVE/INSTALL COVER WITH PADDING FOR BACKREST ON DRIVER SEAT	14AW	91A42 36	

WIS-References			
Document number	Title	Note	Allocation
AR91.10-P-1095LF	Remove/install front seat backrest padding		Remedy

Validity		
Vehicle	Engine	Transmission
222.004	*	*
222.032	*	*
222.033	*	*
222.057	*	*
222.067	*	*
222.077	*	*
222.082	*	*
222.085	*	*

222.104	*	*
222.123	*	*
222.132	*	*
222.133	*	*
222.157	*	*
222.162	*	*
222.163	*	*
222.165	*	*
222.167	*	*
222.176	*	*
222.177	*	*
222.178	*	*
222.179	*	*
222.182	*	*
222.184	*	*
222.185	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
222.004	651.921	724.208
222.032	642.861	722.903
222.032	642.861	725.011
222.033	642.867	722.966
222.057	276.960	724.206
222.057	276.960	725.011
222.067	276.824	725.041
222.077	157.985	722.931
222.082	278.929	722.909
222.082	278.929	725.011
222.085	278.929	722.967
222.085	278.929	725.041
222.104	651.921	724.208
222.123	642.861	722.903
222.123	642.861	725.011
222.132	642.861	722.903
222.132	642.861	725.011
222.133	642.867	722.966
222.157	276.960	724.206
222.157	276.960	725.011
222.162	276.824	722.904
222.162	276.824	725.011
222.163	276.824	724.204

222.165	276.824	722.904
222.165	276.824	725.011
222.167	276.824	722.961
222.167	276.824	725.041
222.176	277.980	722.932
222.177	157.985	722.931
222.178	157.985	722.971
222.179	279.980	722.932
222.182	278.929	722.909
222.182	278.929	725.011
222.184	278.910	725.041
222.185	278.929	722.967
222.185	278.929	725.041

Attachments

Pic 1.jpg:



Pic 2.jpg:



Pic 3.jpg:



Pic 4.jpg:

