

Model series 222, creaking noises from driver seat when cornering

Topic number	LI91.40-P-059981
Version	3
Design group	91.40 Seat belts, emergency tensioning retractors
Date	12-10-2014
Validity	Model series 222 up to VIN A120665
Reason for change	Description and picture changed

Complaint:

Creaking noise in driver seat when cornering.

Cause:

The noise is produced between the guide of the seat belt buckle anchor fitting and the parts moving relative to it (studs, plate). (pic.1)

Attachments	
File	Description
PIC 1.jpg	Noise from area of seat belt buckle

Remedy:

Apply synthetic grease between the sector gear and the stud for the EVO tensioner mounting on the seat belt buckle. (pic.2)

It must be ensured that the synthetic grease is applied cleanly in front of and behind the shaft, as well as between the stud and the gear.

Attachments	
File	Description
PIC 2.jpg	Grease between and behind the marked areas

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 001 989 46 51			SYNTHETIC GREASE / DBL 6827.60	1	Remedy	X

Work units				
Op. no.	Operation text	Time	Damage code	Note
			91A1Y 36	
			91N1Y 36	

WIS-References			
Document number	Title	Note	Allocation
AR91.10-P-1200LF	Remove/install lining on front seat frame		Remedy