

BR223/BR206 Oil level indicator in workshop mode is not correctly displayed

Topic number	LI54.30-P-073761
Version	3
Function group	54.30 - Instrument cluster, display instruments, hazard warning device
Date	9/26/22
Validity	Model series 223 as of code 802 Model series 206
Reason for change	Damage code added

Complaint

The oil level is not correctly displayed while the instrument cluster display is in workshop mode.

The oil level is reported in an inverted fashion when a correction is carried out. I.e. instead of an instruction to refill the oil quantity, an instruction to reduce the oil level is displayed, or vice versa.

Cause

Previous software release for instrument cluster control unit (N133/1)

Remedy

Update instrument cluster control unit (N133/1) software using XENTRY Diagnosis

Symptoms
Power generation > Engine lubrication/oil cooling > Function > Oil level too high
Power generation > Engine lubrication/oil cooling > Function > Oil level too low
Overall vehicle > Cleaning system > Cleaning system indicator lamp > Washer fluid level > lit

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			820EB**	Enter LI number in the warranty claim text