

Initial startup not possible after replacement of TRANSMISSION 725.0 or of electrohydraulic controller unit

Topic number	LI27.00-P-068206
Version	2
Function group	27.00 - General
Date	10/27/22
Validity	All vehicles with TRANSMISSION 725.0
Reason for change	Clarify Wording

Complaint

After replacement of the TRANSMISSION 725.0 or of the electrohydraulic controller unit (EHS), no software is found during the initial startup routine in XENTRY

Cause

The wrong or the old SA code (Option code) is documented in VeDoc for the newly installed transmission or the newly installed electrohydraulic controller unit, EHS (ValveBody).

Remedy

Redocument the new SA code in VeDoc according to the EPC footnote for the transmission or electrohydraulic controller unit (EHS) ordered, and then perform initial startup.

Current SA-codes

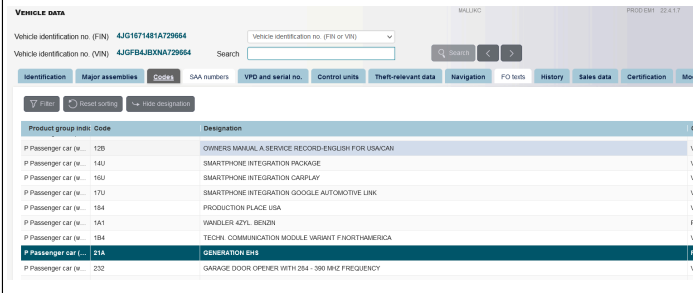
EHS part no. --> SA-code ("Generation EHS")

A725 270 10 03 --> 18A

A725 270 30 04 --> 19A

A725 270 33 04 --> 20A

A725 270 19 05 --> 21A

Attachments	
File	Description
VeDoc Code Location.PNG	Example of SA code as seen in VeDoc
	

XENTRY TIPS

Symptoms
Power transmission > Automatic transmission > Function > Malfunction
Power transmission > Automatic transmission > Function > Electrical fault/Fault code
Power transmission > Automatic transmission > Function > Stalls engine
Power transmission > Automatic transmission > Function > Poor shift quality

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note