

Noise From Front Seat Backrest Trim Strip With Code 735

Topic number	LI91.10-P-074890
Version	1
Function group	91.10 - Front seats
Date	5/27/22
Validity	Model series 223
	Only code 735 (Additional trim element scope)
	Cleanpoint 21.05.2022
Reason for change	

Complaint

Noise between inner side of trim element and seat-back lining

Attachments	
File	Description
Video 1.mp4	
Video 2.mp4	


Cause

Narrow tolerance concept

Remedy


Lubricate both ends of trim element using lubricant (A0009893660).

See red marking in attachment, Pic 1 / Pic 2

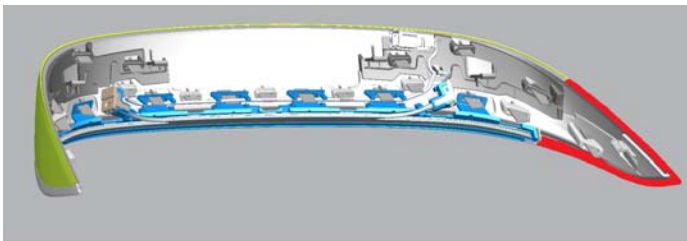Attachments	
File	Description
Pic 1.png	
	

XENTRY TIPS

Pic 2.png

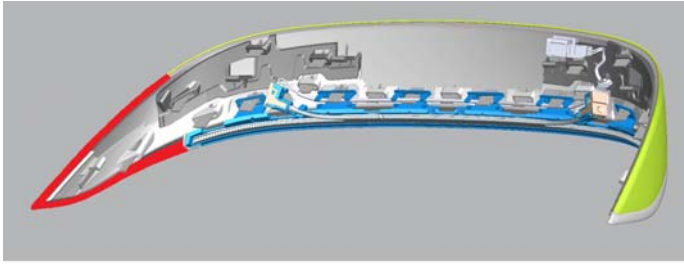

Symptoms

Body > Seat > Noises > Cracking

Body > Seat > Noises > Grunting

Body > Seat > Noises > Creaking

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0009893660			LUBRICANT	1		X

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
	Trim element at rear top of seat backrest on front seat, left		91D09	
	Trim element at rear top of seat backrest on front seat, right		91S09	