

## Warning Message "Steering" - No Power Steering Following Engine Start

---

Topic number	LI46.35-P-075511
Version	1
Function group	46.35 - Electrical steering
Date	11/29/22
Validity	Model series 206, 223, 295, 296, 297, 232, 254
Reason for change	

---

### Complaint

Power steering unavailable following engine start, warning message in instrument cluster.

Fault codes in electric power steering control unit (N68).

Fault code details/freeze frame data of the fault codes show the following values:

P063500: "The electric power steering has a malfunction. There is a component fault." - Mon\_ID 40

P063547: "The electric power steering has a malfunction. There is a runtime error." - Mon\_ID 33

P063509: "The electric power steering has a malfunction. \_" - Mon\_ID 938

### Cause

Software error when starting the electric power steering control unit (N68).

### Remedy

Perform software update of electric power steering, control unit N68.

Please also observe the guided check in XENTRY Diagnosis!

Symptoms
Chassis/suspension > Steering system > Function > Support
Chassis/suspension > Steering system > Function > Stiff/sluggish
Chassis/suspension > Steering system > Function > Support starts too late

Control unit/fault code	
Control unit	Fault text

# XENTRY TIPS

---

N68 - Electrical power steering (ES) (EPS223)	<p>P063509 - The electric power steering has a malfunction. There is a component fault.</p> <p>P063547 - The electric power steering has a malfunction. There is a runtime error.</p> <p>P063500 - The electric power steering has a malfunction.</p> <p>—</p>
---	--

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note