

Repair Order Detail - Customer Copy

RO Number: 218740

RO Status: CLOSED

Customer: CORNEJO, STEVE

scorejo@eaglecontainerinc.com

Phone(s): Contact: (909)900-7420

Main: (909)900-7420

Cell: (909)900-7420

Vehicle: WDDNG77X08A153714

2008 S63AMG

BLACK

7ELG259

Mileage: 84,860

Payment type: VM

Waiter: No

Service advisor: 167

Promised time: 05:00 PM

Estimate: 0.00

Tag number: T5167

Promised date: 02/13/2015

~~~~~  
A CLIENT REPORTS THE CHECK ENGINE LIGHT IS ON. IN PREVIOUS. REFER TO RO#218561

| NOTE          | CP          | SEE STORY    |                      |
|---------------|-------------|--------------|----------------------|
| Tech(s): 152  |             |              | 596.60               |
| 159-141-05-80 |             | 2 METAL SEAL | 23.10                |
| 004-990-53-12 |             | 10 SCREW     | 19.60                |
| 019-997-13-48 |             | 8 O-RING     | 37.84                |
| Pts: 80.54    | Lbr: 596.60 | Other: 0.00  | Total Line A: 677.14 |

Story: 84860 INTAKE MANIFOLD GASKETS LEAKING 380 CONNECT BATTERY CHARGER, CONNECT SDS AND PERFORM SHORT TEST. FOUND RANDOM MISFIRE CODES IN CYLINDER #1, 3 AND 5. PERFORM LEAK TEST OF ENGINE INTAKE SYSTEM. FOUND WHEN ENGINE IS HOT, INTAKE MANIFOLD GASKETS LEAK. R/R INTAKE MANIFOLD, CHECK AND REPLACE LEAKING INTAKE MANIFOLD GASKETS.

~~~~~  
B CLIENT REPORTS THE ENGINE HAS A REAL NOTICIBLE MISFIRE AT IDLE AND WHILE DRIVING. CHECK AND ADVISE

NOTE	CP	SEE STORY	
Tech(s): 152			0.00
Pts: 0.00	Lbr: 0.00	Other: 0.00	Total Line B: 0.00

Story: 84860 SEE LINE A

~~~~~  
C Perform California state COLD tire inflation check and correction as mandated by state law AB32

| PSI          | CP        | Perform California state COLD tire inflation check and correction as mandated by state law AB32 |                    |
|--------------|-----------|-------------------------------------------------------------------------------------------------|--------------------|
| Tech(s): 152 |           |                                                                                                 | 0.00               |
| Pts: 0.00    | Lbr: 0.00 | Other: 0.00                                                                                     | Total Line C: 0.00 |

~~~~~  
D CAR WASH

CW	CP	CAR WASH	
Tech(s): 999			0.00
Pts: 0.00	Lbr: 0.00	Other: 0.00	Total Line D: 0.00

~~~~~  
E ATTENTION SHOP FOREMAN: QUALITY CONTROL INSPECTION. SHOP FOREMAN INITIALS \_\_\_\_\_

| FOREMAN | CP | ATTENTION SHOP FOREMAN: QUALITY CONTROL INSPECTION. SHOP FOREMAN INITIALS _____ |      |
|---------|----|---------------------------------------------------------------------------------|------|
|         |    |                                                                                 | 0.00 |

# Repair Order Detail - Customer Copy

RO Number: 218740

RO Status: CLOSED

Customer: CORNEJO,STEVE

[scorejo@eaglecontainerinc.com](mailto:scorejo@eaglecontainerinc.com)

Phone(s): Contact: (909)900-7420

Main: (909)900-7420

Cell: (909)900-7420

Vehicle: WDDNG77X08A153714

2008 S63AMG

BLACK

7ELG259

Mileage: 84,860

Payment type: VM

Waiter: No

Service advisor: 167

Promised time: 05:00 PM

Estimate: 0.00

Tag number: T5167

Promised date: 02/13/2015

-----

|          |      |      |      |        |      |               |      |
|----------|------|------|------|--------|------|---------------|------|
| Tech(s): | 999  |      |      |        |      |               |      |
| Pts:     | 0.00 | Lbr: | 0.00 | Other: | 0.00 | Total Line E: | 0.00 |

F\*\* SPARK PLUG REPLACEMENT.PERFORM INSPECTION OF SPARK PLUGS FIRST, IF THE SPARK PLUGS ARE INCORRECT PLEASE REPLACE WITH THE CORRECT MERCEDES BENZ APPROVED SPARK PLUGS AND SAVE OLD SPARK PLUGS FOR CLIENT.

NOTE CPM SEE STORY 0.00

|          |      |      |      |        |      |               |      |
|----------|------|------|------|--------|------|---------------|------|
| Tech(s): | 152  |      |      |        |      |               |      |
| Pts:     | 0.00 | Lbr: | 0.00 | Other: | 0.00 | Total Line F: | 0.00 |

Story: 84860 R/R SPARK PLUG FOR INSPECTION. FOUND NEW MB SPARK PLUGS INSTALLED IN ENGINE. NO REPAIR PERFORMED.

G\*\* CLIENT APPROVED TO PERFORM TRANSMISSION WET CLUTCH RE-ADAPTATION AS PER TECH RECOMMENDATION

NOTE CP SEE STORY 157.00

|          |      |      |        |        |      |               |        |
|----------|------|------|--------|--------|------|---------------|--------|
| Tech(s): | 152  |      |        |        |      |               |        |
| Pts:     | 0.00 | Lbr: | 157.00 | Other: | 0.00 | Total Line G: | 157.00 |

Story: 84860 PEROFRM ME AND TRANS. CONTROL UNIT SOFTWARE UPDATRE 100 CHECK ME AND TRANSMISSION CONTROL UNIT SOFTWARE AND PERFORM SOFTWARE UPDATE OF BOTH CONTROL UNITS.

H\*\* REVISED ESTIMATE TO \$1488.54 SPOKE TO STEVE CORNEJO ON 02/12/15 AT 10:46AM TO REPLACE INTAKE MANIFOLD GASKETS, SPARK PLUGS AND RE-ADAPT TRANSMISSION WET CLUTCH

REVEST CP REVISED ESTIMATE 0.00

|          |      |      |      |        |      |               |      |
|----------|------|------|------|--------|------|---------------|------|
| Tech(s): | 999  |      |      |        |      |               |      |
| Pts:     | 0.00 | Lbr: | 0.00 | Other: | 0.00 | Total Line H: | 0.00 |

|                           |        |
|---------------------------|--------|
| Customer Pay              |        |
| Labor                     | 753.60 |
| Parts                     | 80.54  |
| Lube                      | 0.00   |
| Sublet                    | 0.00   |
| Miscellaneous/Shop Charge | 0.00   |
| Deductible                | 0.00   |
| Total Charges             | 834.14 |
| Less Insurance/Adjustment | 0.00   |
| Sales Tax                 | 6.44   |
| Total                     | 840.58 |

# Repair Order Detail - Customer Copy