



**DTB**

Date: August 8, 2007  
Order No.: P-B-27.60/80a  
Supersedes: P-B-27.60/80 dated August 30, 2006  
Group: 27

**Revision History**

Revision	Date	Purpose
a	8/8/07	Addition of Note Pertaining to Fault Code
-	8/30/06	Initial issue

**SUBJECT: Model 171.454/456**  
**Model 203.052/054/056**  
**Model 209.356/372/456/472**  
**Model 211.056/072/256**  
**Model 219.372**  
**Model 221.171**  
**Model 230.471**  
**After Programming Engine and/or Transmission Control Units, Fault Code 061B**  
**Stored in Transmission Control Unit**

If you encounter the situation described in the above model vehicles, the cause may be a torque interface issue between the engine and transmission control modules.

To resolve, check for and install newer software for the engine control module using SDS and perform SCN coding of the engine control module as well. Perform quick test and erase fault code.

**i Note:** If the fault code 061B reappears, it can be ignored. This is not cause for any parts replacement.

**i Note:** If no newer software is available for the engine control module, simply perform the SCN coding of the engine control module.

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.