

SUBJECT: DEALER TECHNICAL BULLETIN 44/00

44/00-2 GROUP 54 - MODEL E55 (210.074), REDUCED POWER DURING HARD ACCELERATION: If you receive complaints on model E55 of reduced power during hard acceleration that may be caused by the numbers in the upper load range long-term adaptation moving toward the lower limit under certain driving conditions, i.e. the engine is running too lean under high load condition. For this complaint, install ME-SFI engine control module part number 026 545 3132 with modified software. The modified ECU is identified with a "Q3" (or higher) on the parts sticker. Software date of the new software is 15/00 (or higher).

Service Engineering

HHdg

7-25-00

064387