 
 



AF15.30-U-6405A	Starter occasionally does not operate	18.1.01
-----------------	---------------------------------------	---------

ENGINE 112, 113

Damage code	Cause	Remedy	
03 024 08	 Starting operation is terminated before engine can start. When starting tachometer jumps momentarily in direction > 2000 RPM.	 DTC in ME-SFI control module: No DTC stored. 1 Remove starter	
		ENGINE 112.942, 113.942	AR15.30-P-7100GH
		2 Coat teeth on starter ring gear lightly with grease.	
		 Use only grease specified in parts ordering notes. Ensure that excessive quantity of grease is not applied because this can interfere with the signal pickup of position sensor L5.	
		3 Install starter.	

Parts ordering notes

Part no.	Designation	Quantity
000 989 76 51	Paste (1kg)	1