
AR01.45-P-7500TV Remove/install oil pan 2.3.10


ENGINES 112.913 in MODEL 211.061 /261 ENGINES 112.949 in MODEL 211.065 /265 ENGINES 113.967 in MODEL 211.070 /270 ENGINES 113.990 in MODEL 211.076 /276

- 6 Front axle carrier
- 8 Bolts
- 10 Lower steering shaft
- 14 Engine mount bolts

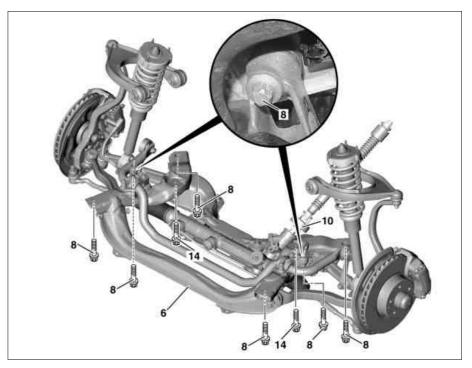

P01.45-2092-06

- 2 Oil dipstick guide tube
- 4 Bracket
- 5 Bracket
- 6 Front axle carrier
- 9 Oil pan bottom section
- 10 Lower steering shaft

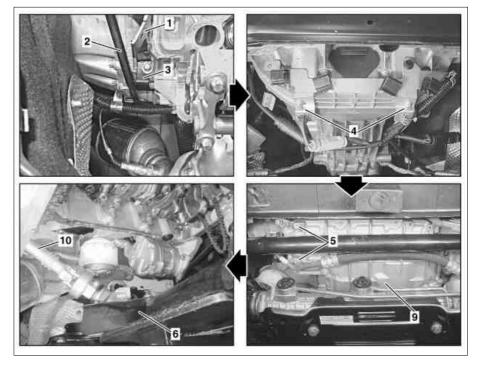

P01.45-2093-06


XX	Remove/install		
⚠ Danger!	Risk of death caused by vehicle slipping or toppling off of the lifting platform.	Align vehicle between columns of vehicle lift and position four support plates at vehicle lift support points specified by vehicle manufacturer.	
⚠ Danger!		-	AS00.00-Z-0009-01A
(1)	Notes on self-locking nuts and bolts		AH00.00-N-0001-01A
(9)	Notes on bolted connections with self tapping screws		AH00.00-P-0007-01SF

1	Deactivate easy entry/exit function	Vehicles with memory package (driver seat, steering column, mirrors) code 275		
2	Turn front wheels to straight-ahead position and secure steering wheel with [3] holding device.	The steering wheel must not be turned when the steering coupling is detached, otherwise the clock spring contact will be destroyed.	*129589012100	
3	Remove oil pan bottom section (9)	Except model 211.076/276 Model 211.076/276	AR01.45-P-7555PV AR01.45-P-7555R	
4	Disconnect electrical connector from SPS [PML] solenoid valve	Vehicles with speed-sensitive power steering, code 213 See "Remove rack-and-pinion steering".	AR46.20-P-0600T	
5	Remove steering coupling from bottom steering shaft (10)	1 0	AR46.10-P-8000T	
6	Support front subframe (6)		AR33.10-P-0100-03T	
7	Remove suspension strut at front to spring control arms	Engine 113	AR32.25-P-1017TA	
8	Remove bolts (8) from front axle carrier (6)	 The bolts are self-tapping, therefore the following is to be observed, in order to assure a proper function: Never re-tap thread in longitudinal member. When screwing in do not attach bolts at an angle Do not use an impact wrench. Observe tightening torque. 		
9	Lower front axle carrier (6)	When lowering the front axle carrier (6) ensure that lower steering shaft (10) is not damaged, in order to assure a proper function.		
10	Remove bracket (4, 5) on oil pan top section			
11	Remove oil baffle for oil pan top section	Engine 113.990		
12	Detach the oil pan top section from the crankcase	i Installation: Observe different bolt lengths and diameters: ↓		
		Bolt plan for oil pan	*BA01.45-P-1001-01B	
13	Remove oil pan top section	i Remove oil dipstick guide tube (2) upward. i Installation: Apply sealant to the sealing surface of the oil pan: ↓ Notes on application of sealant to oil pan:		
		Engine 112	AH01.45-P-0001-01PV	
i		ŭ		
i		Engine 113	AH01.45-P-0001-01R	
		3	*112589002500	
		Loctite sealant 5970	*BR00.45-Z-1013-01A	
	Clean			
14	Clean sealing surfaces on oil pan top section and on crankcase	Do not use any sharp-edged tools or abrasive paper as this will damage the sealing surfaces. Loctite 7200 Cleaning spray, Loctite 7063 (150ml)	*BR00.45-Z-1038-04A *BR00.45-Z-1046-04A	
15	Install in the reverse order	Sistering Spray, Locille 7000 (100111)	D1100.75-Z-1040-04A	
16	Perform wheel alignment check		AR40.20-P-0200T	
⚠ Danger!	Risk of accident caused by vehicle starting off by itself when engine is running. Risk of injury caused by contusions and burns during starting procedure or when working near the engine as it is running	Secure vehicle to prevent it from moving by itself. Wear closed and snug-fitting work clothes. Do not touch hot or rotating parts.	AS00.00-Z-0005-01A	
17	Carry out engine test run, checking the engine for proper operation and leaks			

Nm Oil pan

Number	Designation			Engine 112.910/911/ 912/913/914/ 915/917/920/ 921/922/923/ 940/941/942/ 943/944/945/ 946/947/949/ 951/954/955/ 960/961/970/ 972/973/976	Engine 113.940/941/ 942/943/944/ 945/946/960/ 961/962/963/ 965/967/968/ 969/980/981/ 982/984/986/ 992/995	Engine 113.990
BA01.45-P-1001-01B	Bolt, oil pan to cylinder crankcase	M6	Nm	9	9	9
		M8	Nm	20	20	20



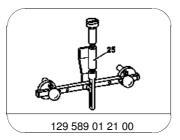

Squeeze gun

Holding device

Repair materials

Number	Designation	Order number
BR00.45-Z-1013-01A	Loctite sealant 5970	A 003 989 98 20
BR00.45-Z-1038-04A	Loctite 7200	Henkel Loctite Deutschland GmbH Arabellastrasse 17 81925 München Germany Tel. +49 899268-0 Fax + 49 899101978 www.Loctite.de
BR00.45-Z-1046-04A	Cleaning spray, Loctite 7063 (150ml)	A 001 986 71 71 10