

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

BR213 - WRINKLING IN LEFT AND RIGHT SEAT CUSHION COVERS ON REAR BENCH SEAT



Mercedes-Benz

- BR213 - Wrinkling In Left And Right Seat Cushion Covers On Rear Bench Seat -

Topic number	LI91.12-P-066074
Version	2
Function group	91.12 Rear seats
Date	06-15-2020
Validity	Equipment code: P22 (EXCLUSIVE interior) and 801 or 814 or 815
Reason for change	New optimized rear seat cushion covers available.

Complaint

Wrinkling in left and right seat cushion covers on rear bench seat with Exclusive Leather special equipment

File

BR213_faltige_Fond_bezuege.jpg

Designation

Example of the complaint: Wrinkled rear seat covers

Cause

Due to the casual seat covering concept (floating, without stapling at the rear of the surface) and the extremely soft material used (nappa leather), stretching of the material may occur even with normal customer use. This stretching of the material appears in the form of a dent in the surface of the seat cushion.

Remedy

Replacement of the rear seat cover.

The optimized rear seat cover with additional stitching (transverse seam) can be ordered through the EPC.

WIS references

Document number	Title	Note	Allocation
ar91.18-p-1850lwe	Remove/install cover on rear seat cushion	Validity: Model 213 except code 248 (rear seat with integral child seat)	Remedy

Symptoms

Symptom

Body / Seat / Seat cover / Folds

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			9200417	

BR213_faltige_Fond_bezuege

