

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

CRACKING NOISE WHEN TRUNK LID IS OPENED



Mercedes-Benz

- Cracking noise when trunk lid is opened -

Topic number	LI88.50-P-067780
Version	1
Function group	88.50 Trunk lid
Date	03-01-2018
Validity	MODEL 213.0/1 with CODE 881 up to production date Jan 31 2018
Reason for change	

Complaint

When the trunk lid reaches the upper limit stop, a cracking noise may be heard sporadically.

Cause

Under certain circumstances, the actuation of the KDS (trunk lid control) drive unit might not be shut off in time when the upper normalization value is reached; this can cause the snap coupling to slip. No damage is done to the system by the coupling slipping.

Remedy

Perform SCN coding of KDS control unit (N121). Afterwards, normalization of the trunk lid control is required.

Symptoms

Symptom

Body / Door/Flap / Hood/flap / Trunk lid/liftgate / Noise

Control unit/fault code

Control unit	Fault code	Fault code description
N121 - Trunk lid control (KDS) (PTCM213)	-	-

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			8211C36	

