

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

## MOISTURE IN AREA OF A-PILLAR TRIM/HEADLINER AT FRONT LEFT OR RIGHT



Mercedes-Benz

# - Moisture in area of A-pillar trim/headliner at front left or right -

Topic number	LI77.00-P-055046
Version	5
Function group	77.00 General
Date	01-17-2019
Validity	All vehicles with code 414
Reason for change	Damage code updated

## Complaint

Moisture in area of A-pillar trim/headliner at front left or right.

## Cause

Discharge flow rate from A-Pillar water drain grommet (in area of wheel arch) insufficient.

## Remedy

Replace water drain grommet (see EPC).

## Symptoms

### Symptom

Body / Body/Cab / Body sealing / Water entry

Body / Roof system / Tilting/sliding sunroof system / Leaks

## Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 204 639 13 94			Water drain grommet	2	left and right	X

## Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			78B011A	Sliding roof hose water drain grommet

78P011A

Sliding roof hose  
water drain  
grommet