

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

## NOISES FROM DOOR PANEL IN AREA OF BELTLINE - BR213



Mercedes-Benz

# - Noises From Door Panel In Area Of Beltline - BR213 -

Topic number	LI72.10-P-071097
Version	1
Function group	72.10 Front door
Date	03-06-2020
Validity	BR213
Reason for change	

## Complaint

Noises from door panel in area of beltline, BR213 (front and rear doors).

## Cause

There may be contact points between the trim element and the door panel. The contact between the components can produce creaking noises in the area of the beltline.

## Remedy

Treat the outer edges of the trim element with special lubricant A 000 989 36 60. To do this, remove the trim element. Pictures of the areas to be treated are included in the attachment and are marked in color.

### File

Zierteil.JPG.jpg

### Designation

Trim element - Areas to be treated marked in red

## WIS references

Document number	Title	Note	Allocation
AR72.10-P-1000LW	Remove/install door lining on front door		Remedy
AR72.12-P-1010LW	Remove/install door lining on rear door		Remedy

## Symptoms

### Symptom

Body / Door/Flap / Door / Door / Noise

Body / Door/Flap / Door / Trim / Noise

## Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0009893660			Lubricant	1		

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
72-6405	REMOVE/INSTALL INNER DOOR PANEL OF FRONT DOOR	6		Damage code of relevant door panel (72E01/72T01/73E01/73T01)
72-7156	REPLACE TRIM ELEMENT ON INNER DOOR PANEL OF 1ST DOOR	4		Damage code of relevant door panel (72E01/72T01/73E01/73T01)

Zierteil

