

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

## OUTSIDE MIRROR FOLDING OUT/IN NONFUNCTIONAL



Mercedes-Benz

# - Outside mirror folding out/in nonfunctional -

Topic number	LI72.40-P-069934
Version	1
Function group	72.40 Door control
Date	06-27-2019
Validity	MODEL 205 FACELIFT with code 809 MODEL 213 with code 808 or 809 MODEL 238 with code 809 MODEL 222 FACELIFT with code 808 or 809 MODEL 217 FACELIFT with code 808 or 809
Reason for change	

## Complaint

The outside mirror cannot be folded in or out.

## Cause

There may be a possible software error in door control unit (N69/1 and N69/2).

## Remedy

Flash door control units DCU/Vx (N69/1 and N69/2) with repair software.

The repair software with add-on 12398 for XD-DVD 03/19 and 05/19 and/or as of XD-DVD 07/19

Note: Replacing parts does not remedy the complaint

## Symptoms

### Symptom

Body / Door/Flap / Outside mirror / Power folding mirrors / Malfunction

## Control unit/fault code

Control unit	Fault code	Fault code description
N69/1 - Left front door (DCU-LF) (DMFL222_MOPF)	-	-
N69/2 - Right front door (DCU-RF) (DMFR222_MOPF)	-	-

## Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			72220EW	
			72230EW	