

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

REPLACE COVER FOR POSITIVE POLE ON STARTER BATTERY

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin


Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin



Mercedes-Benz

Campaign No. 2018110002, November 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Models C-Class (205 platform) and E-Class vehicles (213 platform)**
Model Year 2018
Replace cover for positive pole on starter battery

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year ("MY") 2018 C-Class (205 platform) and E-Class vehicles (213 platform), an incorrect cover for the starter battery may have been installed which provides insufficient cover for a live electrical wire. Therefore, in the event of a crash which results in substantial deformation of the strut brace above the battery, the strut brace could contact an uncovered live electric wire which could lead to a short circuit. A short circuit could lead to an increased risk of fire. In this case, the on-board electrical system might not be able to support post-crash functions (e.g. emergency door unlocking or activation of hazard warning lamps may not be available). However, unlocking and opening of the doors from the inside are not affected. An authorized Mercedes-Benz dealer will replace the battery cover on the affected vehicles.

Prior to performing this Recall Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 4073 vehicles are involved.

Order No. P-RC-2018110002
This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Procedure

1. Lift cover (A, Figure 1).
2. Lift interior air filter (B, Figure 1).
3. Replace cover for positive pole (C, Figure 1) on starter battery.

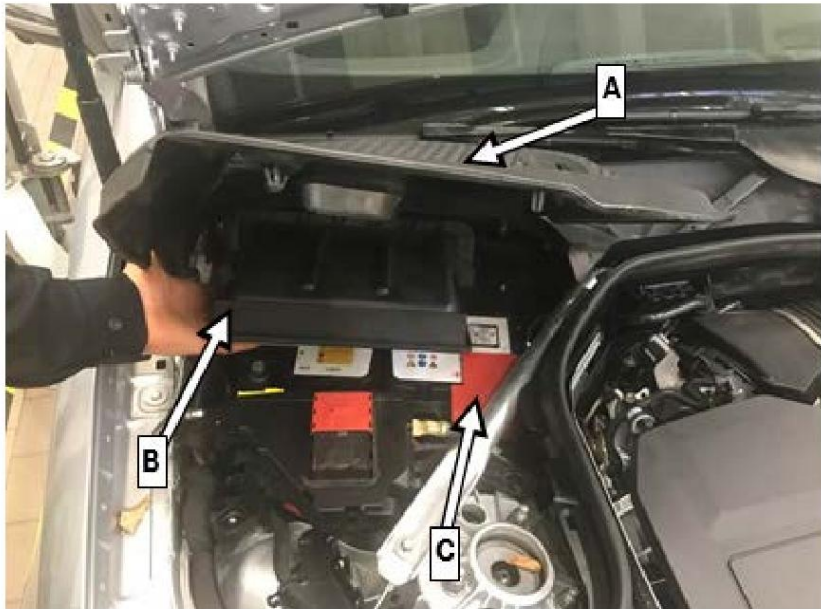


Figure 1

4. Assemble in reverse order.

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Cover for positive pole (insulating cap)	A 000 546 85 02	100%

Warranty Information

Operation: Replace positive pole cover of starter battery(02-2720)

Damage Code	Operation Number	Labor Time (hrs.)
54 906 33 7	02-2720	0.1

i Note

Operation Number labor times are subject to change.