

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

## CREAKING NOISE ON FRONT SEAT WHEN CORNERING



Mercedes-Benz

# - Creaking noise on front seat when cornering -

<b>Topic number</b>	LI91.10-P-067955
<b>Version</b>	2
<b>Function group</b>	91.10 Front seats
<b>Date</b>	04-09-2018
<b>Validity</b>	BR213
<b>Reason for change</b>	Pictures for remedy added.

## Complaint

Creaking noise on front seat when cornering.

### File

BR213\_Sitzlehnenverkleidung Geräusch.mp4

### Designation

Squeaking noise on seat backrest

## Cause

The fastening hooks (Pic 1) on the seat-back lining rub up against the functional carrier hooks (Pic 2) and cause a noise.

### File

Pic1.JPG.jpg

Pic2.jpg

### Designation

Fastening hooks on seat-back lining without felt

Functional carrier

## Remedy

1. Disassemble seat-back lining on front seat AR91.10-p-1910lw

2. Perform test drive without backrest seat-back lining.

If the noise is no longer present, continue with operation step 3.

If the noise is still present, look for source of noise elsewhere.

3. Cut felt (A000 983 71 10) to size and fasten as in Pic 3.1, Pic 3.2 and Pic 4 on both fastening hooks on the seat-back lining.

4. Mount seat-back lining onto front seat AR91.10-p-1910lw

### File

Pic3.1.jpg

Pic3.2.jpg

Pic4.JPG.jpg

### Designation

Felt half mounted onto fastening hooks of seat-back lining

Felt completely mounted onto fastening hooks of seat-back lining

Fastening hooks on seat-back lining with felt

## Symptoms

### Symptom

Body / Seat / Noises / Cracking


Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 983 71 10			Felt	1	Felt	X

Pic1




Pic2

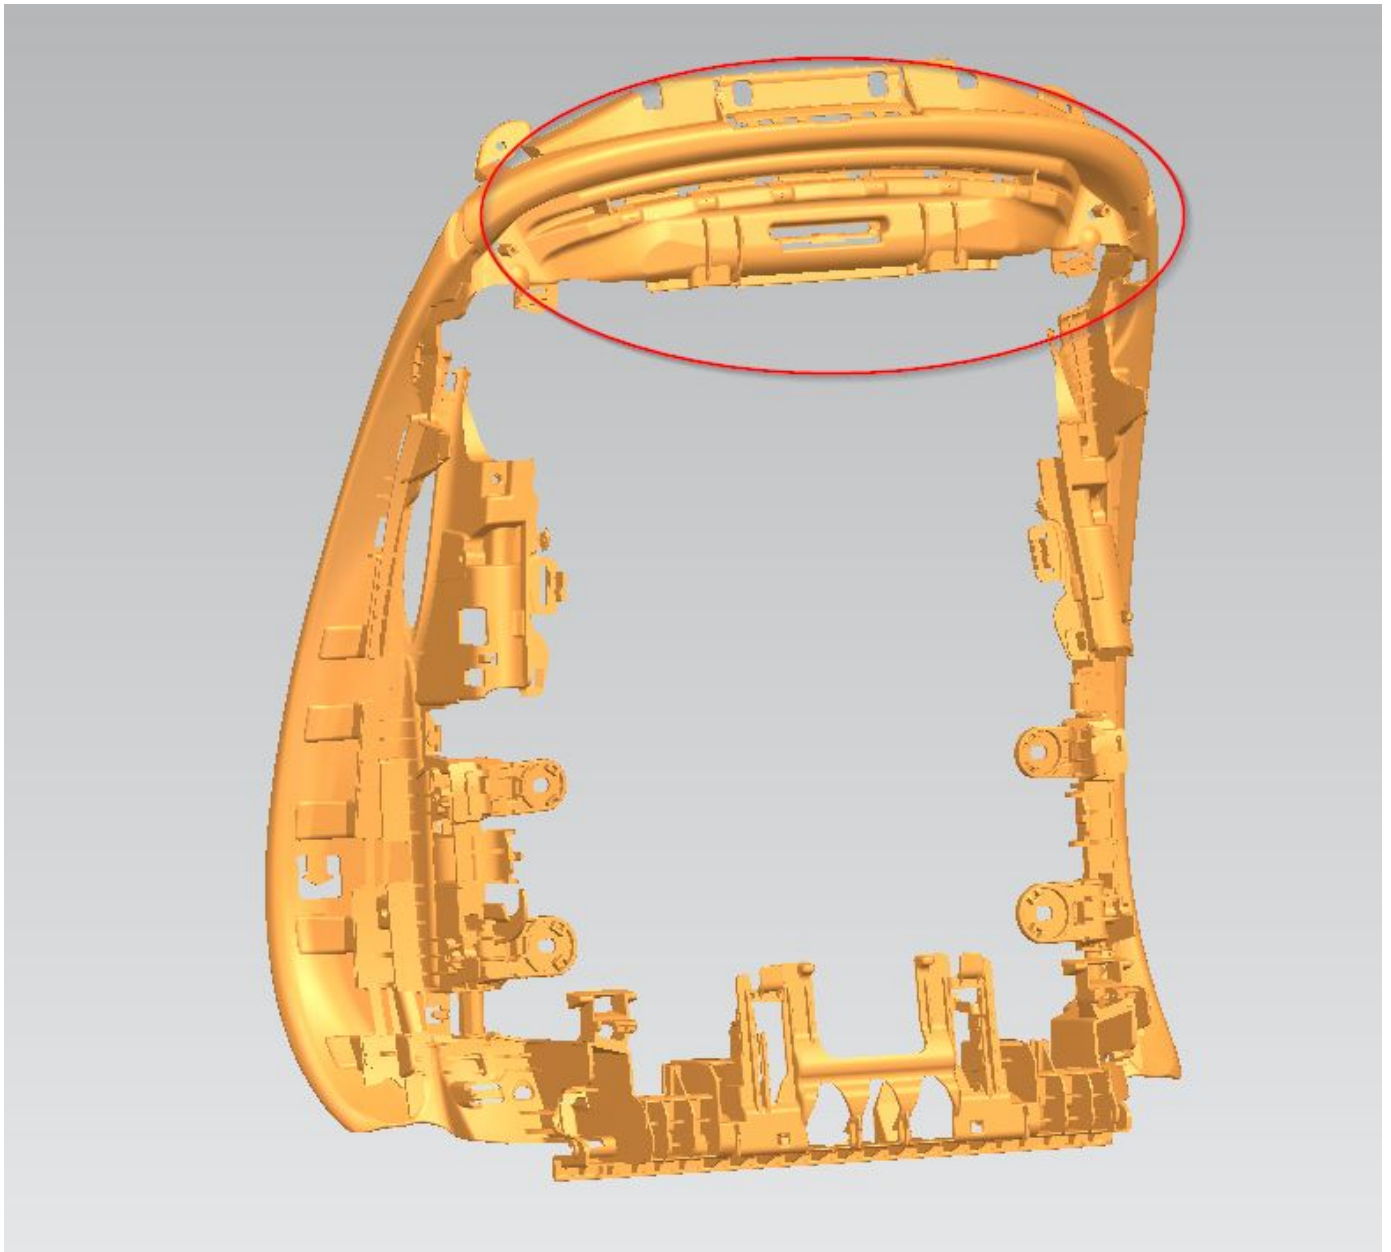**Pic3.1**



**Pic3.2**



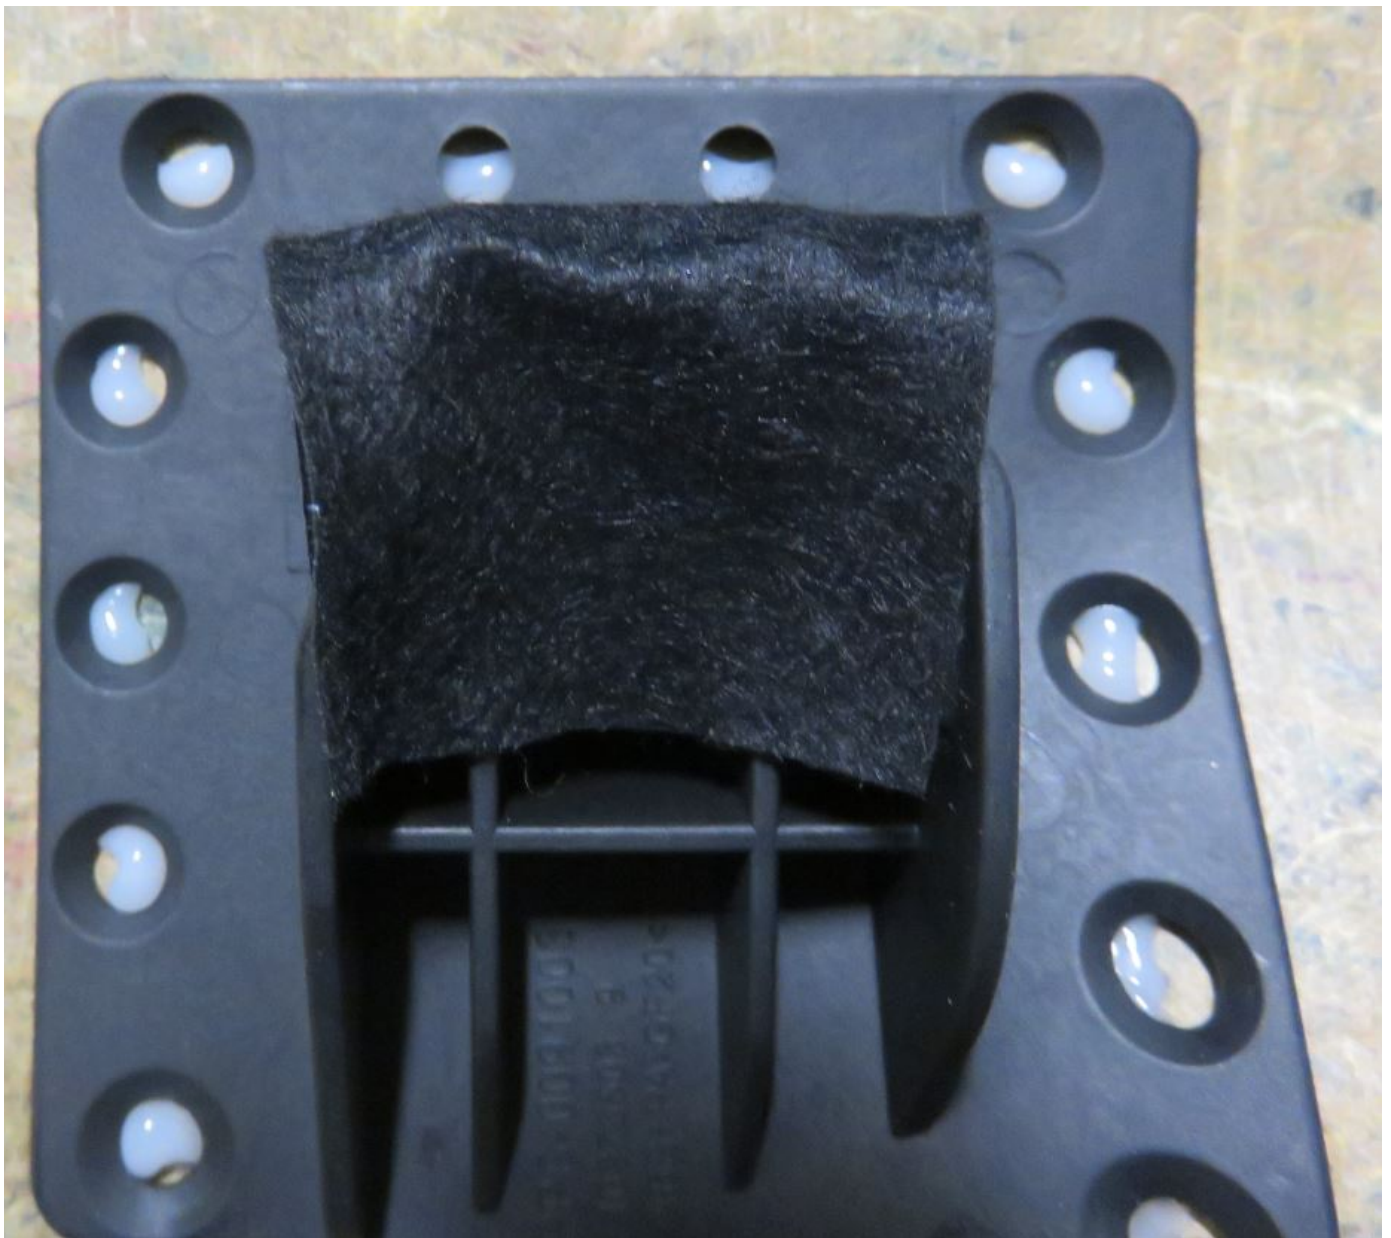

**Pic4**

