

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

## CREAKING NOISES FROM SEAT CUSHION LENGTH ADJUSTMENT (SKTE) IN VEHICLES WITH MEMORY PACKAGE (CODE 275)



Mercedes-Benz

# - Creaking noises from seat cushion length adjustment (SKTE) in vehicles with Memory Package (code 275) -

<b>Topic number</b>	LI91.10-P-067673
<b>Version</b>	1
<b>Function group</b>	91.10 Front seats
<b>Date</b>	02-02-2018
<b>Validity</b>	BR 213 with SA code 275 (Memory Package) up to manufacturing date 16.03.2017
<b>Reason for change</b>	

## Complaint

Creaking noises on loading the electrical seat cushion length adjustment (SKTE) in retracted state. Audible at the front of the thigh/knee pad.

### File

Video 1.mp4

### Designation

Example of noise development

## Cause

Contact between plastic lever of seat cushion and cushion shell (signs of abrasion visible on cushion shell).

## Remedy

- Remove seat cushion cover and seat cushion padding
- Stick felt strips (approx. 10x8 cm) onto cushion shell of seat (see pictures, illustrated without the SKTE lever). It is not necessary to remove the seat for this.

### File

Pic.1.jpg

Pic.2.jpg

### Designation

Signs of abrasion on cushion shell. No felt attached.

Felt strips attached to cushion shell.

## Symptoms

### Symptom

Body / Seat / Noises / Grunting

## Parts


Part number	ES1	ES2	Designation	Quantity	Note	EPC
-------------	-----	-----	-------------	----------	------	-----

A 000 983 71  
10

Felt 1

Roll material  
must be cut  
to the  
required size. X

Pic.1

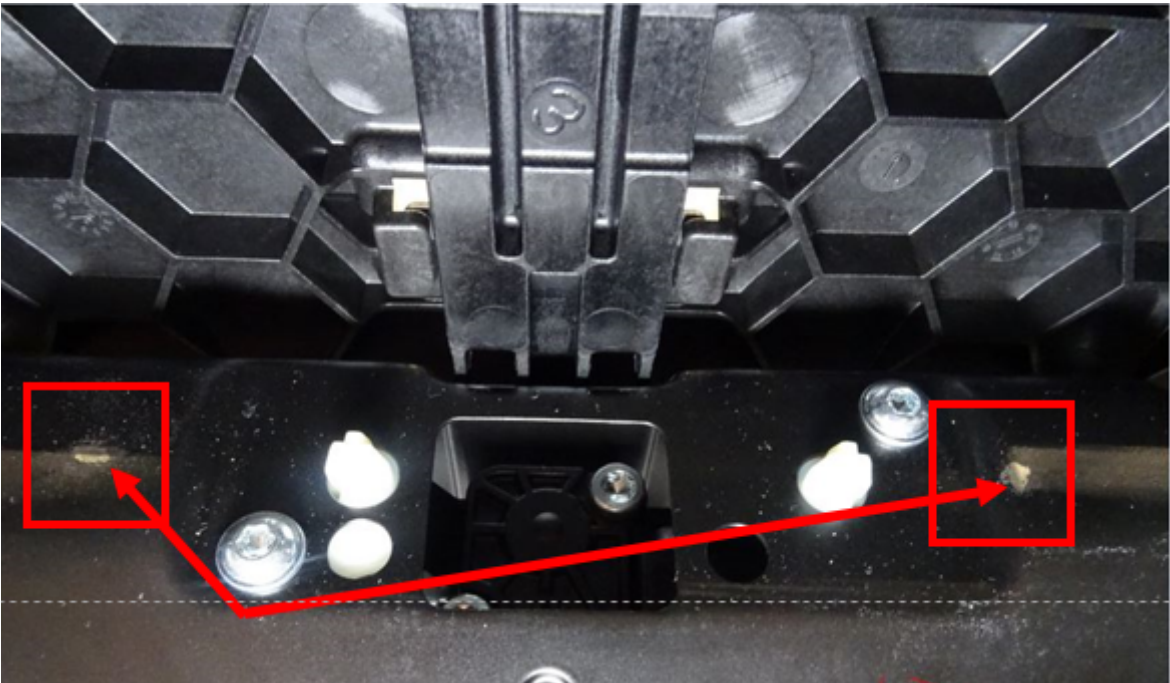

Pic.2

