

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

RETROFIT PROTECTIVE GRILLE FOR ADDITIONAL COOLER

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2019040010, May 2019

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model E-Class and GLC-Class (213, 253 platform)**
Model Year 2018-2019
Retrofit protective grille for additional cooler

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year ("MY") 2018-2019 E-Class and GLC-Class (213, 253 platform) vehicles, the installed stone chip guard does not correspond to current production specifications. As a result, this may allow stones to contact the radiator. An authorized Mercedes-Benz dealer will retrofit a protective grille on the affected vehicles.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 3104 vehicles are affected.

Order No. P-SC-2019040010

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

 
 
 

 

 
Service Campaign Bulletin

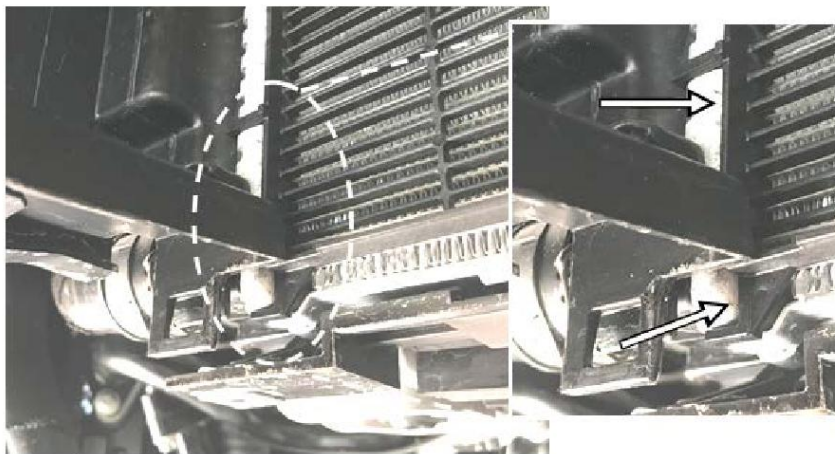
Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

1. Remove front section of engine compartment lining.
 -  For basic data of model 213, see **AR61.20-P-1105LWE**
 -  For basic data of model 253, see **AR61.20-P-1105LW**
2. Unclip additional cooler with connected lines and detach downwards.
 -  Coolant **must not** be drained.
 -  Coolant lines **must not be** disconnected.
 -  For basic data of model 213, see **AR20.20-P-3867MNE**
 -  For basic data of model 253, see **AR20.20-P-3867MNG**
3. Insert protective grille from underneath (**figure 1**) and attach on left and right at corners (**figure 2**) of additional cooler.
 -  Protective grille is mounted flush with the cooler edge.

**Figure 1****Figure 2**

P-SC-2019040010

4. Press lugs of protective grille into slats of additional cooler (**figure 3**).
- i

Protective grille is then flush with additional cooler.
- i

There is no contact between the lugs on the protective grille and fluid pipes.

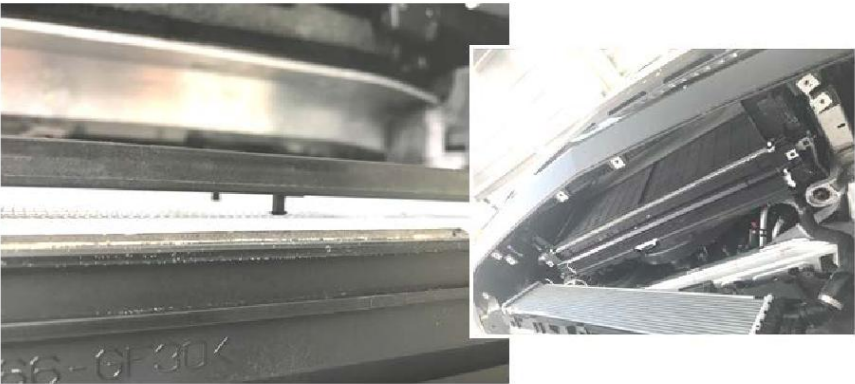


Figure 3

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
1	Protective grille	A 099 503 01 00	100%

Warranty Information

Operation: Retrofit protective grille for additional cooler (02-2788)		
Damage Code	Operation Number	Labor Time (hrs.)
88 911 01 7	02-2788 (213)	0.6
	02-2788 (253)	0.5

i

Note

Operation Number labor times are subject to change.