

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

SQUEAKING NOISE FROM THE EXHAUST FLAP



Mercedes-Benz

- Squeaking Noise from the Exhaust Flap -

Topic number	LI49.10-P-064655
Version	4
Function group	49.10 Exhaust pipes, mufflers
Date	07-10-2020
Validity	AMG vehicles with exhaust gas flaps
Reason for change	Validity supplemented to include vehicles with M176

Complaint

Squeaking noise from the exhaust gas flap and is audible at standstill with light abrupt acceleration and during normal driving

Cause

Insufficient lubrication on flap shaft

Note:

Replacing components does not remedy the problem

Remedy

1. Remove components of exhaust system, if necessary
2. Remove affected actuator
3. Spray shaft of exhaust gas flap with high-temperature grease (see picture 1 and picture 2)
4. Check, during a test drive, if the noise has been rectified
5. If necessary, repeat procedure

Note :

The arrows show the locations where the lubricant is to be applied.

File	Designation
Bild 1.JPG.jpg	Picture 1
Bild 2.JPG.jpg	Picture 2

WIS references

Document number	Title	Note	Allocation
AR49.10-P-	Remove/install components of exhaust system		Remedy

Symptoms

Symptom

Power generation / Exhaust system / Noises / Noise

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 989 91 51			High-temperature grease	1	Can be used for several vehicles	X

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			14C02**	
			14R02**	
			14335H2	Models: A; CLA; GLA

Bild 1

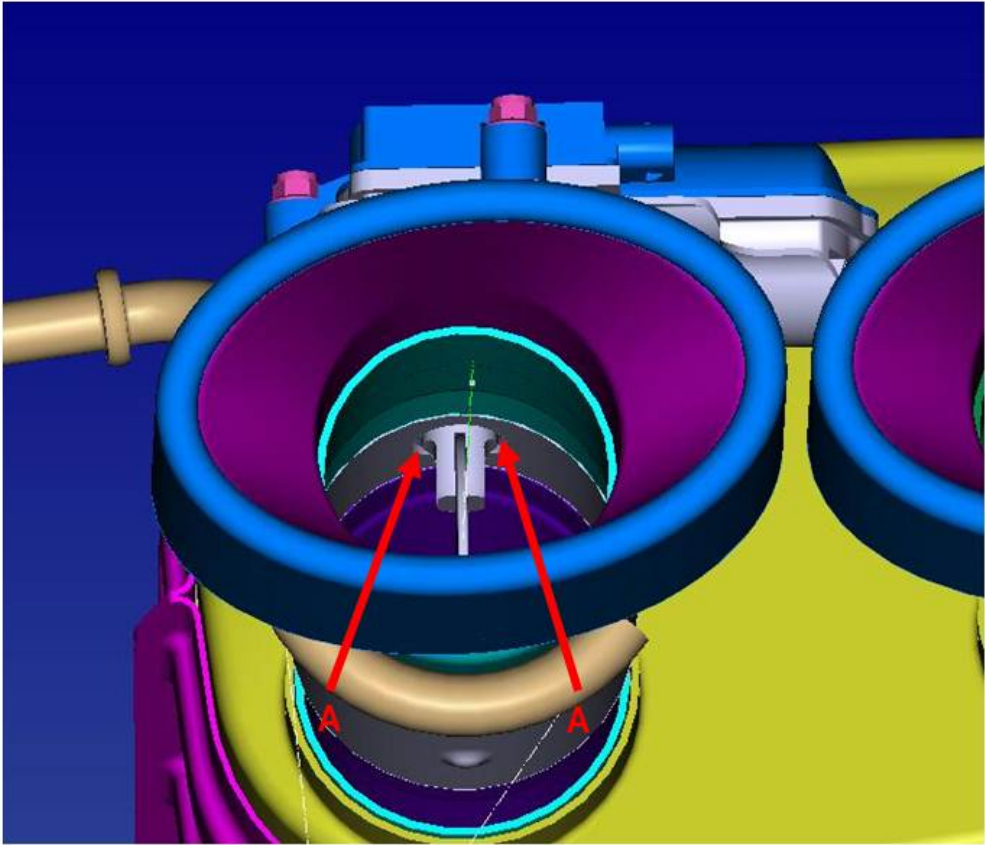


Bild 2

