

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

WHISTLING NOISES FROM AREA OF FRONT AXLE BRAKES WHILE DRIVING  
AT APPROX. 80-100 KM/H



# - Whistling noises from area of front axle brakes while driving at approx. 80-100 km/h -

<b>Topic number</b>	LI42.10-P-066240
<b>Version</b>	2
<b>Design group</b>	42.10 Service brake
<b>Date</b>	06-12-2017
<b>Validity</b>	For all vehicles with the following brakepads in EPC: A 008 420 06 20 A 008 420 08 20 These must be replaced in accordance with the parts note.
<b>Reason for change</b>	Validity revised

## Complaint

Whistling noises from the area of the front axle while driving at approx. 80-100 km/h.

## Cause

Self-excited vibration between the left front inner brakepad and the brake disk (stick/slip effect).

## Remedy

Replace brakepad as per specifications.

File	Designation
top-cut.JPG.jpg	Top-Cut

## Symptoms

### Symptom

Chassis/suspension / Brake system / Service brake / Noises / Squeals

## Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 420 30 02			Brake pad	1	Order brakepad when EPC indicates this brakepad: A 008 420 06 20	X

A 000 420 29  
02

Brake pad 1

Order  
brakepad  
when EPC  
indicates this X  
brakepad: A  
008 420 04 20

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
40-1590	REMOVE/INSTALL WHEELS (2)		4212536	
42-2693	REMOVE/INSTALL BRAKE PADS OF FRONT AXLE, REPLACE IF NECESSARY (WHEELS REMOVED)		4211436	

top-cut

