

2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

SEAT CUSHION FORE/AFT ADJUSTER SEAT CUSHION COVER BECOMES DETACHED



Mercedes-Benz

- Seat cushion fore/aft adjuster seat cushion cover becomes detached -

Topic number	LI91.18-P-049463
Version	3
Function group	91.18 Seat covers
Date	07-31-2018
Validity	BR204 and 207 with SA code 409 (Multicontour seat) and BR212 with SA code 409/432 (Multicontour seat/active multicontour seat) BR 205 and 213 with SA code P65 (Seat cushion fore/aft adjustment) and with 275 (Electrically adjustable driver seat with memory function) or 241 (Electrically adjustable front seats) or 242 (Electrically adjustable front passenger seat with memory function)
Reason for change	BR213 added

Complaint

The fastening strip for the seat cushion cover becomes detached from the front of the seat cushion shell.

Cause

- Model series 204 and 212: Insufficient holding ability of the fastening strip
- Model series 207: Matting incorrectly positioned. (See picture P1040937)
- Model series 205 and 213: Insufficient holding ability of the fastening strip

File
P1040937.JPG.jpg

Designation
Matting trapped in profile

Remedy

- Model series 204 and 212:
- Remove cushion as per AR91.10-P-3310CW
- Fit clips as described in the attachment
- Reattach cover accurately

! It is important that the metal protrusions in the edge of the cushion shell still protrude noticeably and that the fastener clicks firmly and audibly into place !

- Model series 207:
- Remove cushion as per AR91.10-P-3310CW

! Remove the folded matting from the fold, reattach the cover accurately and make sure that the fastener clicks firmly into place !

- Model series 205 and 213:
- Remove front seat cushion as per AR91.10-P-3310LWA

- Remove cover from front seat cushion as per AR91.18-P-1800LW

- On the base plate (13) of the seat cushion fore/aft adjuster, position 2x retaining clips approx. 5mm from the marking and press in flush with the edge of the base plate (Pic3)

! Reattach the cover accurately and make sure that the fastener clicks firmly into place !

File	Designation
Bezug lost sich bei MKL.pdf	Position of spring clip
Pic3.pdf	Retaining clips on base plate (13)

WIS references

Document number	Title	Note	Allocation
AR91.18-P-1800CW	Remove/install cover on front seat cushion	Model series 204, 207, 212 - It is only necessary to partially remove the cover	Remedy
AR91.10-P-3310LWA	Remove/install seat cushion	Model series 205 - With seat cushion fore/aft adjustment	Remedy
AR91.18-P-1800LW	Remove/install cover on front seat cushion	Model series 205	Remedy

Symptoms

Symptom

Body / Seat / Seat cover / Detaches

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 991 98 70			Spring clip	3	Model series 204 207 212	X
A 001 988 63 78			Retaining clip	2	Model series 205	X


Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			91A0438	Left front seat cushion cover loose
			91N0438	Right front seat cushion cover loose

P1040937



LI91.18-P-049463_2

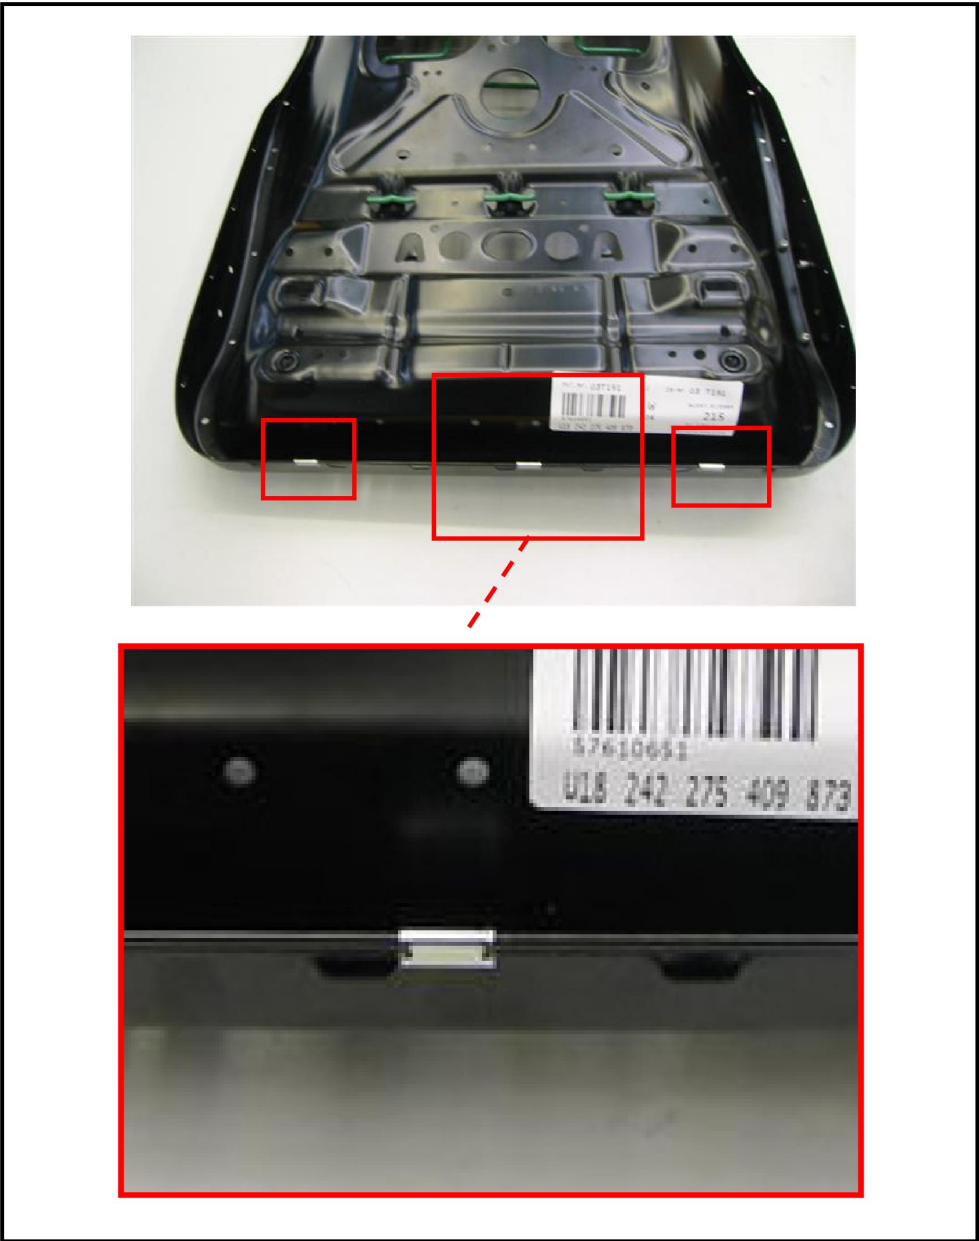

LI91.18-P-049463_3

