Model 166

up to model year 2016

Model 204.9

with code 220 (PARKTRONIC) with code 430 (Offroad package)


with code 873 (Seat heating for driver and front passenger)

Model 207, 212, 218

## Shown on model 204.9 up to model year 2013

Panel
 Screw

N72/1 Upper control panel control unit

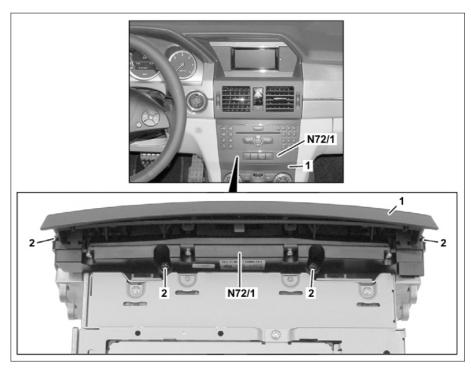

P54.21-3011-06

<b>(b)</b>	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
X	Remove/install		
1	Remove radio	Model 166 up to model year 2016 Model 204.9	AR82.60-P-7502GQ AR82.60-P-7502CY
		as of model year 2013 with code 220 (PARKTRONIC) with code 430 (Offroad package)	AR02.00-P-7502C1
		with code 510 (Audio 20 CD with 6-disc CD changer) with code 512 (COMAND APS with DVD changer) with code 523 (Audio 20 CD)	
		with code 527 (COMAND APS with single DVD drive (with navigation)) with code 873 (Seat heating for driver and front passenger)	
		Model 204.9 up to model year 2013 with code 220 (PARKTRONIC) with code 430 (Offroad package) with code 510 (Audio 20 CD with 6-disc CD	AR82.60-P-7502CW
		changer) with code 511 (Audio 50 APS with DVD changer) with code 512 (COMAND APS with DVD changer)	
		with code 523 (Audio 20 CD) with code 525 (MB Audio 50 APS radio) with code 527 (COMAND APS with single DVD drive (with navigation)) with code 873 (Seat heating for driver and front passenger)	
		Model 207, 212, 218	AR82.60-P-7502EW

2	Unscrew bolts (2)	Unscrew bolts (2) carefully. Otherwise cover (1) can be damaged.	
3	Remove UCP control unit (N72/1) from radio		
4	Unclip cover (1) and remove	Model 166 up to model year 2016 Model 204.9 up to model year 2013 with code 220 (PARKTRONIC) with code 430 (Offroad package) with code 873 (Seat heating for driver and front passenger) Model 212 When replacing the upper control panel control unit (N72/1).	
5	Install in the reverse order		