


MODELS 211.0 /2 /6 up to 14.6.04 with CODE (581) Convenience automatic air conditioning

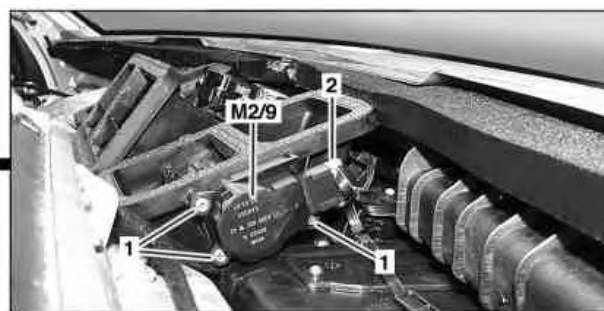

P83.10-2279-07

1 Bolts

2 Electrical connector

M2/9 Right defroster vent flap actuator motor

	Remove/Install		
1	Remove top section of instrument panel		AR68.10-P-1020T
2	Remove bolts (1)		
3	Remove right defroster vent flap actuator motor (M2/9) and disconnect electrical connector (2)	Installation: When replacing the right defroster vent flap actuator motor (M2/), the position of the axle shaft of the right defroster flap must match the position of the right defroster vent flap actuator motor (M2/) actuator drive.	
4	Install in the reverse order		
5	Synchronize the actuator motors	Menu item, Actuation, Normalization of actuator motors	
	Connect STAR DIAGNOSIS and read out fault memory	STAR DIAGNOSIS diagnosis system	AD00.00-P-2000-04A *WH58.30-Z-1048-13A

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00