

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2017100008, November 2017

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Check Camshaft Cover, Adjust if Necessary**
Models 172, 205, 213, 253 model year 2018

Daimler AG ('DAG'), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY18 172, 205, 213, 253, (SLK-Class, C-Class, E-Class, GLC-Class) vehicles, the camshaft cover may not have been correctly installed. As a result, small amounts of oil may leak from the camshaft cover. An authorized Mercedes-Benz dealership will check the camshaft cover and adjust, if necessary.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 2442 vehicles are affected.

Order No. P-SC-2017100008

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

1. Open hood and check cover (A, figure 1) of camshaft.

i The cover **must** be flush **all-round** in the cylinder head housing.
If necessary, press on cover again using a suitable plastic wedge (1, figure 2).
The replacement of the cover is **not** required!

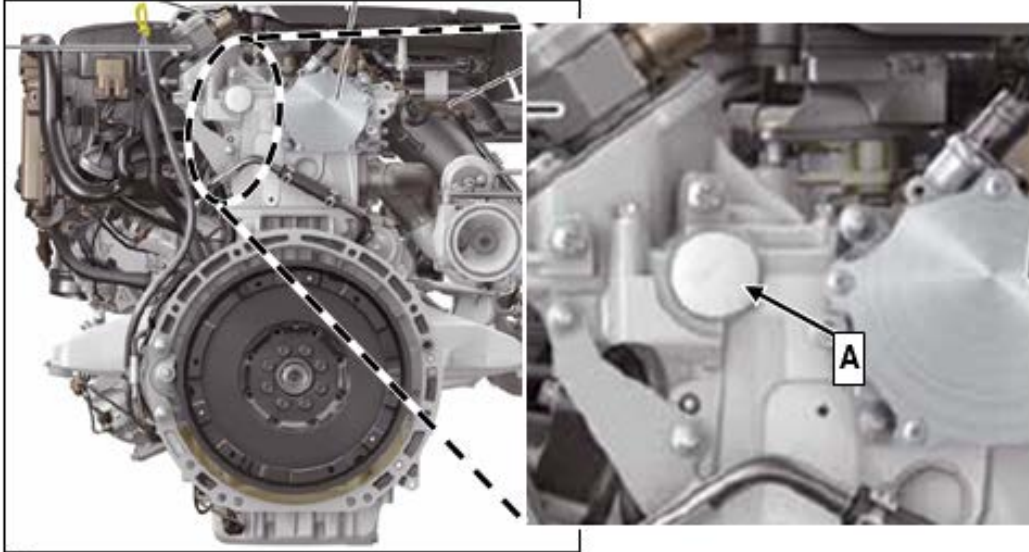


Figure 1



Figure 2

Warranty Information

Operation: Check camshaft cover, adjust if necessary (02-2062)

Damage Code	Operation Number	Labor Time (hrs.)
05 900 35 8	02-2062	0.1

**Note**

Operation Number labor times are subject to change.