


Model 166.0, 292

Model 166.8

Modification notes

28.10.2015	Repair method completely revised.		
------------	-----------------------------------	--	--

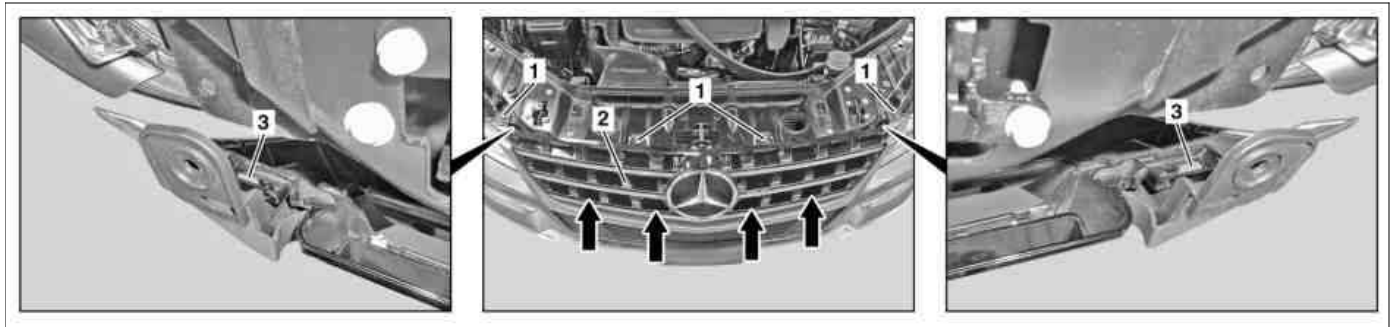

P88.40-2956-07


Shown on model 166.0 up to model year 2016 except code 501 (360° camera)

1 Expansion rivet

2 Radiator grille

3 Catch hook


Shown on model 166.0 as of model year 2016 except code 501 (360° camera)

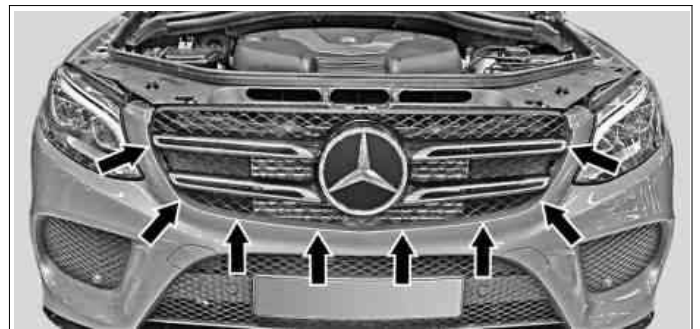


P88.40-3274-10

ⓘ	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
⊞	Remove		
1	Switch on ignition and store transmitter key outside of transmission range (min. 2 m)		
2	Remove cover on radiator support	☑ Long wedge	*115589035900
3	Remove expansion rivets (1)	☑ Clip remover	*452589016300
4	Press catch hooks (3) (arrows) on inside of radiator trim (2) downward with suitable tool and disengage radiator trim (2)		
5	Expose electrical connector on 360° camera at front and disconnect	Model 166.0/8, 292 with code 501 (360° camera)	AR54.30-P-3001GQ
6	Press radiator grille (2) toward rear and remove		
⊞	Install		
7	Position radiator trim (2)		
8	Connect electrical connector to front 360° camera and fasten	Model 166.0/8, 292 with code 501 (360° camera)	AR54.30-P-3001GQ
9	Press radiator trim (2) toward front and remove	ⓘ The catch hooks (3) (arrows) should catch audibly in the radiator trim (2).	
10	Install expansion rivets (1)		

11	Install cover in radiator support		
	Calibrate		
12	Calibrate camera 360° camera with diagnostic unit	Model 166.0/8, 292 with code 501 (360° camera)	
AD			AD00.00-P-2000-04A

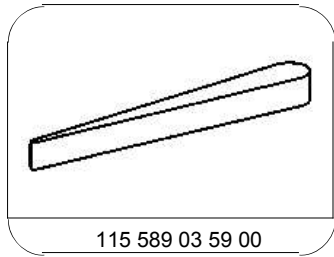

Long wedge

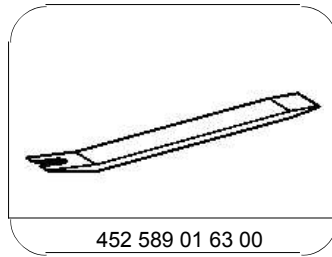

Clip remover