

[Back To Article](#)

AC BLOWER INOPERATIVE DTC 912F87 IN ACC "THE FRONT BLOWER REGULATOR HAS A MALFUNCTION. THE MESSAGE IS MISSING"

DEALER TECH TOPICS; OCTOBER 2014


Reference Number(s): TT 10/14,Â Date of Issue:Â October 2014

MERCEDES-BENZ: Model 166

GROUP: 83.40 - Air conditioning (automatic)

CAUSE / EXPLANATION

Possible connection failure at connector X18(2) pin 2.

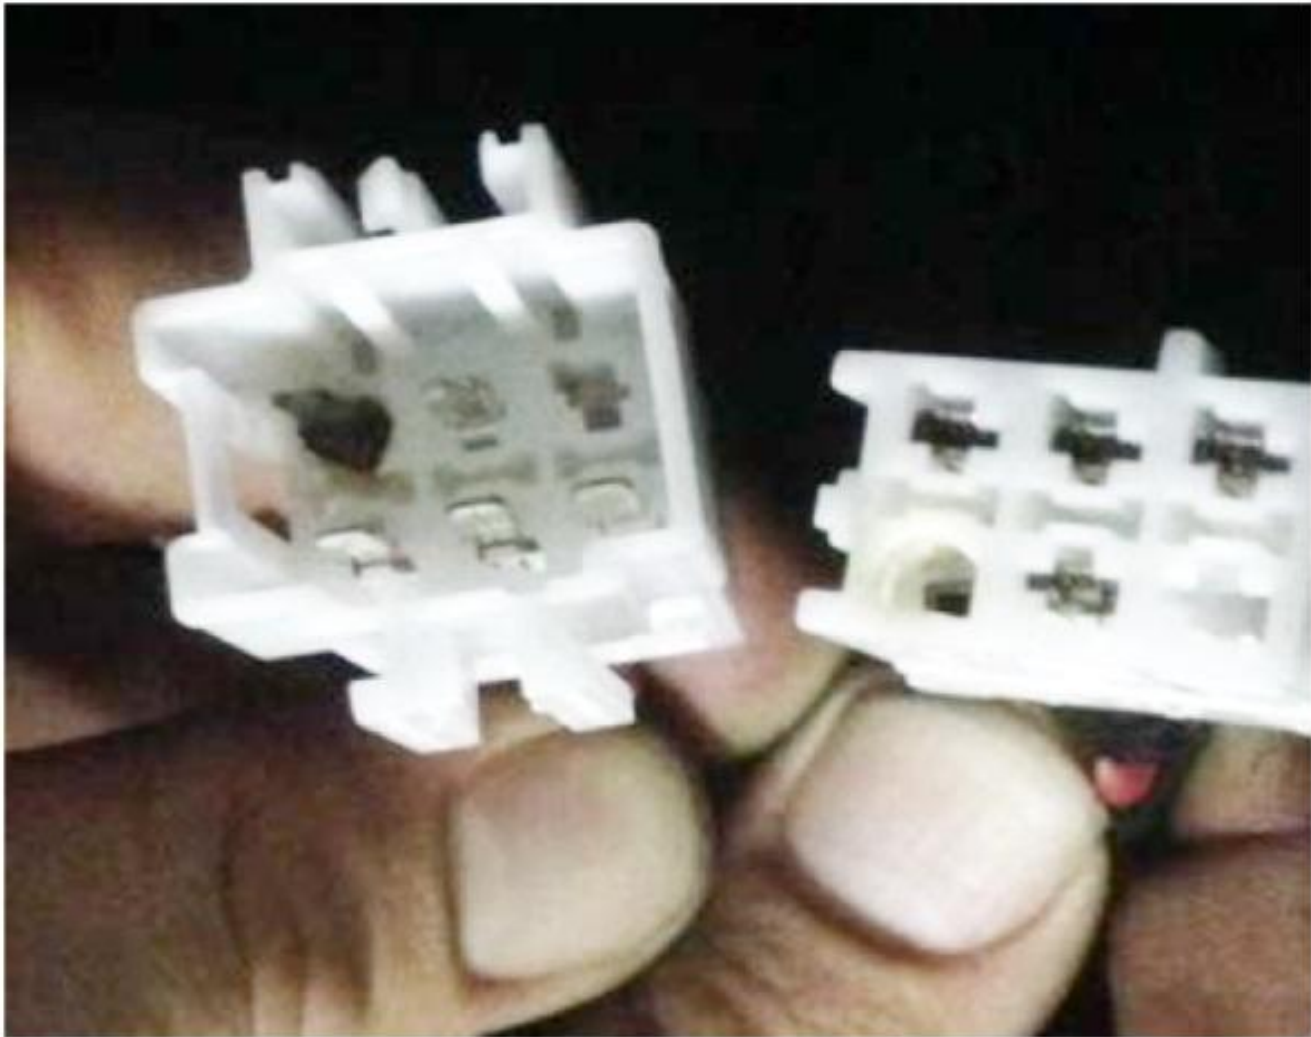

CORRECTION

A0375459428: 6 Pin Housing

A2205456928: 6 Pin Bushing Housing

A0115450726: Female SLK2.8 4.0mm² Pin

A0355457628: Male SLK2.8 4.0mm² Pin

NOTE: If other pins are damaged, refer to wiring diagram for wire size and laminated sheet in Wiring Harness Repair Kit for correct SLK2.8 pins.

