
MODEL 216.3, 221.0 /1

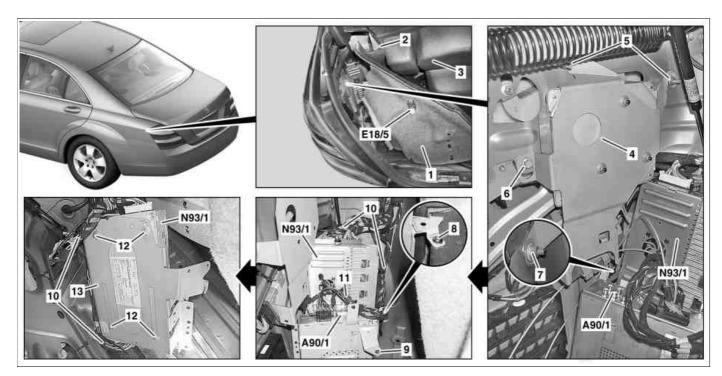

P82.60-5390-09

Shown on model 221

- 1 Side trunk paneling
- 2 Hinge lever passage frame
- 3 Trunk floor paneling
- 4 Bracket
 (with code (218) Backup camera or
 code (390 to 396) Linguatronic or
 code (529) HIGH Class Japan or
 code (813) Voice control system
 (VCS [SBS]))
- 5 Nuts
 (with code (218) Backup camera or
 code (390 to 396) Linguatronic or
 code (529) HIGH Class Japan or
 code (813) Voice control system
 (VCS [SBS]))
- 6 Screw
 (with code (218) Backup camera or
 code (390 to 396) Linguatronic or
 code (529) HIGH Class Japan or
 code (813) Voice control system
 (VCS [SBS]))
- 7 Nut

- 8 Screw
- 9 Bolt (for code (863) Digital/analog TV tuner)
- 10 Wiring harness
- 11 Wiring harness (for code (863) Digital/analog TV tuner)
- 12 Nuts
- 13 Bracket
- A90/1 TV combination tuner (analog/digital) (for code (863) Digital/

analog TV tuner)

E18/5 Left luggage compartment lamp N93/1 Audio tuner control unit

\mathbf{X}	Remove/install		
(3)	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Temporarily store basic data of audio tuner control unit (N93/1) in STAR DIAGNOSIS	When replacing audio tuner control unit (N93/1). i Installation: Copy temporarily stored basic data to new audio tuner control unit (N93/1).	
⊯ AD	Connect STAR DIAGNOSIS and read out fault memory		AD00.00-P-2000-04A
2	Switch off ignition and withdraw transmitter key or Keyless Go start/stop button from the EIS [EZS] control unit	i Keyless Go start/stop button only for vehicles with code (889) Keyless Go.	
3	Remove spare tire well paneling	On model 216	AR68.30-P-4600SX
4	Release trim at side in luggage compartment (1) and swivel to one side until the audio tuner control unit (N93/1) is accessible		AR68.30-P-4600SX
5	Loosen nuts (5) and bolt (6), detach bracket (4) and place to one side with lines connected	For vehicles with code (218) Backup camera or with code (390 up to 396) Linguatronic or with code (529) HIGH Class Japan or with code (813) Voice control system (VCS [SBS])	
6	Remove nut (7)		
7	Unscrew bolt (8)		

8	Unscrew bolt (9)	For vehicles with code (863) Digital/analog TV tuner	
9	Raise bracket (13), place to one side and detach electrical connectors on audio tuner control unit (N93/1)	Do not twist wiring harness (11) (for code (863) Digital/analog TV tuner) and wiring harness (10) too far as otherwise the fiber optic cable may be damaged.	
()	Notes on avoiding damage to fiber optic cables during repair work		AH82.60-P-0001-05AK
10	Undo nuts (12) and remove audio tuner control unit (N93/1) from bracket (13)		
11	Install in the reverse order		