

AP00.20-P-0042SX Reset service indicator 10.5.12

MODEL 216, 221

A1p13 Multifunction display S110s1 Scroll forward/back button S110s3 System selection button "Back" and SBS off button S110s4 S110s6 OK button S111s3 Accept/terminate phone call button

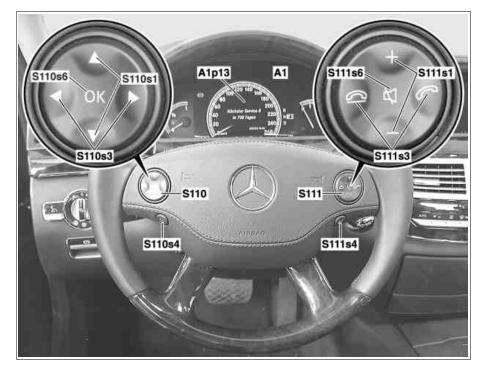

P54.30-9052-06

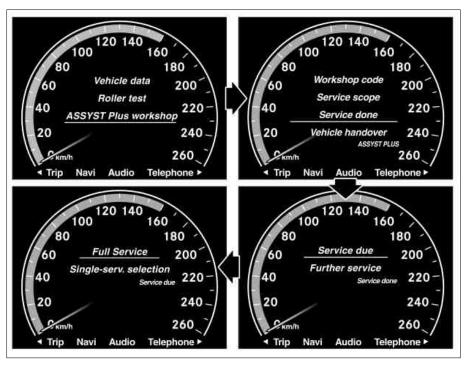

P54.30-9158-06

	Resetting		
1	Close trunk lid, engine hood and doors	Vehicles with code (494) USA version	
2	Turn transmitter key in electronic ignition switch (EIS) control unit to position "1"	i The standard display "kilometer counter" must appear in the multifunction display (A1p13); if necessary, press the system selection button (S110s3) repeatedly until the menu item "Trip" is highlighted.	
3	First press "Accept phone call" control surface of the accept/terminate phone call button (S111s3) and keep pressed, then in addition press OK button (S110s6) and keep pressed for approx. 3 seconds.		
4	Select "ASSYST PLUS workshop" and confirm with OK button (S110s6)		

5	Select "Service Performed" with scroll forward/back button (S110s1) and confirm by pressing OK button (S110s6).		
6	Select "Due Services" or "Other Services" with scroll forward/back button (S110s1) and confirm by pressing OK button (S110s6)	i Select "Due Services" if all service items specified by ASSYST PLUS have been carried out, or if individual service positions have not been carried out and are therefore not to be reset. i Select "Other Services" if individual service items currently not specified by ASSYST PLUS have been carried out and are to be reset in addition to the actual service scope.	
7	Add additional service items to current service scope	If necessary, if "Further services" were selected beforehand.	AP00.20-P-0042-02SX
8	Select "Complete Service" or "Individual Service Selection" with scroll forward/back button (S110s1) and confirm by pressing OK button (S110s6)	i Select "Complete Service" if all service items specified by ASSYST PLUS have been carried out. All service items are reset.	AP00.20-P-0042-01SX
		i Select "Individual Service Selection" if not all service items specified by ASSYST PLUS have been carried out. The service items which have not been carried out can be deselected separately. Deselected service positions are not reset. i To achieve the maximum service interval, engine oil which complies with Specifications for Operating Fluids, Sheet 229.5 must be used and confirmed.	AP00.20-P-0042-01SY
9	Press "back" and VCS [SBS] off button (S110s4) to return to the main menu		
10	Turn transmitter key in electronic ignition switch (EZS) control unit to position "0"		