


MODEL 216

MODEL 221 except CODE (Z07) Top protection

Shown on model 221

- 1 Front engine compartment paneling
- 2 Center engine compartment paneling
- 3 Rear engine compartment paneling

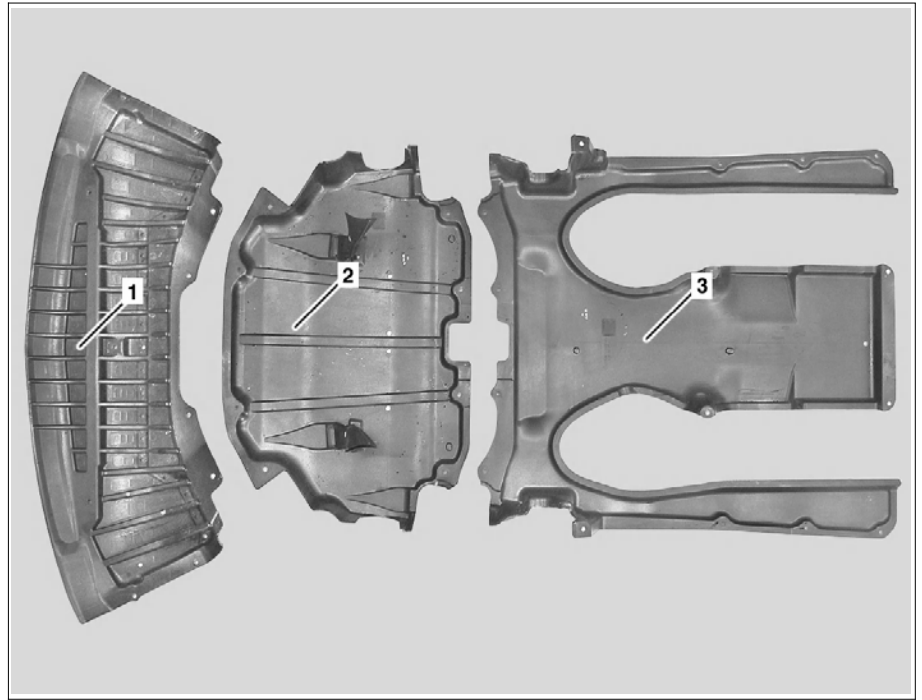

P61.20-2053-06

Modification notes

| | | | |
|--------|---|------------------|--|
| 8.4.09 | Tightening torque for underride guard added | Operation step 3 | |
|--------|---|------------------|--|

| | Remove/install | | |
|---|--|--|---------------------|
| | Risk of death caused by vehicle slipping or toppling off of the lifting platform. | Align vehicle between columns of vehicle lift and position four support plates at vehicle lift support points specified by vehicle manufacturer. | AS00.00-Z-0010-01A |
| 1 | Raise vehicle with vehicle lift | | |
| 2 | Remove front engine compartment paneling (1) | | |
| 3 | Remove center engine compartment paneling (2). | i On vehicles with code (481) Observe underride guard tightening torque Nm | *BA61.40-P-1001-01D |
| 4 | Remove rear engine compartment paneling (3). | | |
| 5 | Install in the reverse order | | |

Nm Underbody protection

| Number | Designation | | Model 221 with code (481) | Model 216 with code (481) |
|--------------------|----------------------------------|----|------------------------------|------------------------------|
| BA61.40-P-1001-01D | Bolt, underbody protection plate | Nm | 17 | 17 |