


Seat cushion of front seat

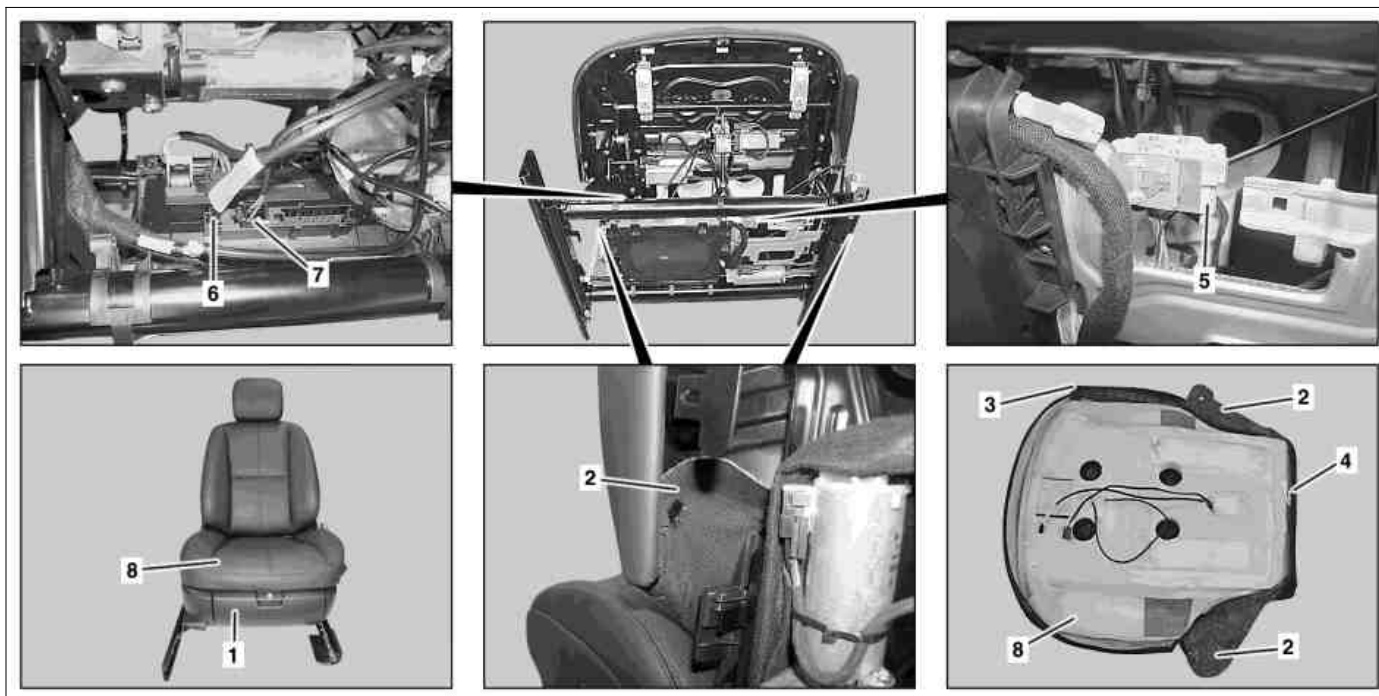



P91.10-2924-09


- | | | |
|---|---|---|
| <p>1 Stowage tray</p> <p>2 Fabric tabs</p> <p>3 Terminal strip</p> <p>4 Terminal strip</p> <p>5 Electrical connector (front passenger seat)</p> | <p>6 Electrical connector
(with code (401) Front deluxe seats,
incl. seat heating and seat
ventilation)</p> | <p>7 Electrical connector
(with code (401) Front deluxe seats,
incl. seat heating and seat ventilation
or code (873) Heated left and right
front seats)</p> <p>8 Seat cushion</p> |
|---|---|---|

Modification notes

22.6.09	Information for WSS (weight sensing system), code (494) USA version included	
---------	--	--

☒ ☒	Remove/install		
i	When replacing the passenger-side seat cushion, the as-built configuration of the installed WSS (weight sensing system) must be determined	On vehicles with code (494) USA version (up to September 4, 2008)	AH91.60-P-0760-01SX
1	Remove left or right front seat		AR91.10-P-1000SX
2	Remove stowage tray (1) on front seat		
3	Remove paneling on front seat frame		AR91.10-P-1200SX
4	Detach backrest frame from front seat	i Detach backrest frame with backrest upholstery from seat frame and place down with electrical lines connected.	AR91.10-P-3331SX
5	Unhook fabric tabs (2)		
6	Loosen clamping strips (3, 4) using a suitable screwdriver		
7	Disconnect electrical connector (5) for front passenger seat occupied and child seat recognition sensor	On vehicles without code (494) USA version, removal of seat cushion (8) at front passenger seat.	
8	Disconnect WSS (weight sensing system) electrical connector	⚠ On vehicles as of September 5, 2008, with code (494) USA version, remove seat cushion with pressure sensor connected. Do not disconnect sealed connectors.	
9	Disconnect electrical connector (6)	On vehicles with code (401) Front comfort seats, incl. seat heating and seat ventilation.	
10	Disconnect electrical connector (7)	On vehicles with code (401) Front comfort seats, incl. seat heating and seat ventilation or code (873) Seat heater for left and right front seat.	

13	Parameterize weight sensing system (WSS) with STAR DIAGNOSIS	For vehicles with code (494) USA version  Menu item "Initial startup of weight sensors". 	*211589003200
----	--	---	-------------------------------

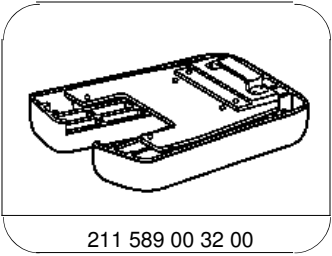

Plates