


Model 222
with code 413 (Automatic panoramic sliding sunroof)

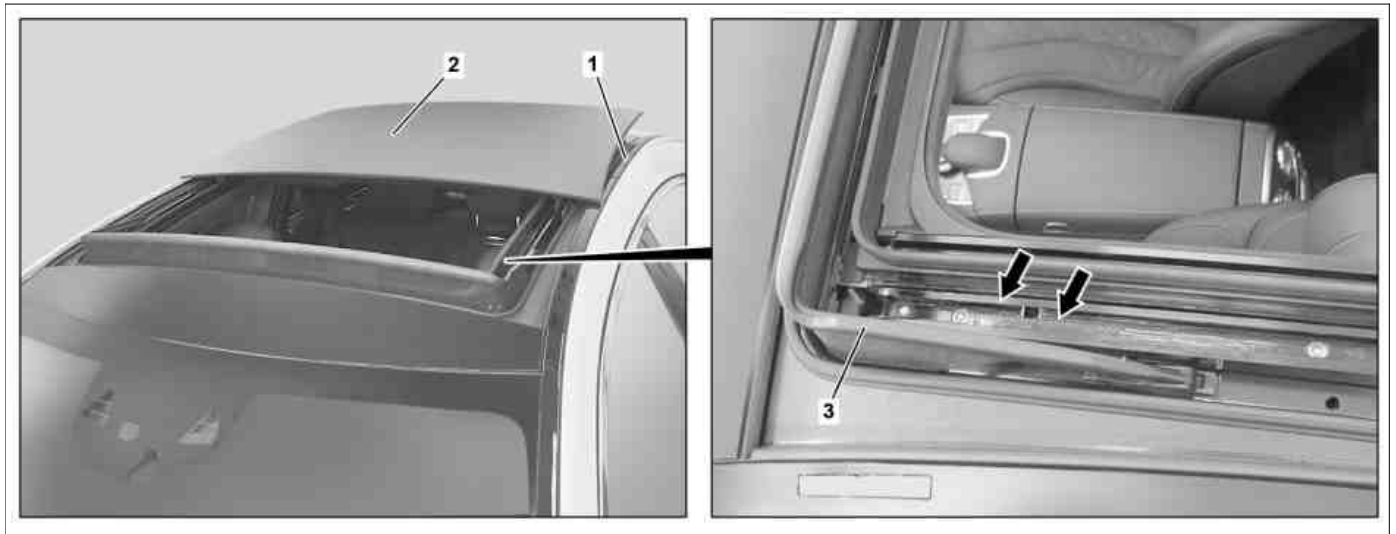

P77.20-2816-08

2 Panoramic sliding sunroof

3 Guide arm

Warning	Risk of injury caused by fingers being jammed or pinched when removing, installing or aligning hoods, doors, trunk lid/rear-end door or sliding roof.	No parts of the body or limbs should be within the operating area when the components are moving.	AS00.00-Z-0011-01A
	Preparatory activity		
1	Open panoramic sliding sunroof (2)		
	Clean		
2	Use rag to clean pivot arm (3) of wind deflector		
3	Use rag to clean entire length of guide rails (arrows)		
	Lubricate		
4	Apply light coating of grease to pivot arm (3) of wind deflector	Synthetic grease, sliding roof 500 g, DB supply specification 6827.60	*BR00.45-Z-1004-06A
5	Apply light coating of grease to contact surfaces of guide rails (arrows) over the entire length	Synthetic grease, sliding roof 500 g, DB supply specification 6827.60	*BR00.45-Z-1004-06A
6	Perform function test on panoramic sliding roof (2)		
7	Remove excess grease		
	Finishing activity		
8	Close panoramic sliding roof (2)		

Repair materials

Number	Designation	Order number
BR00.45-Z-1004-06A	Synthetic grease, sliding roof 500 g, DB supply specification 6827.60	A 001 989 46 51