


**Model** 222  
with code 501 (360° camera)

### Modification notes

|         |   |                  |  |
|---------|---|------------------|--|
| 21.8.15 | Commissioning of front 360° camera using diagnostic system added. | Operation step 6 |  |
|---------|---|------------------|--|

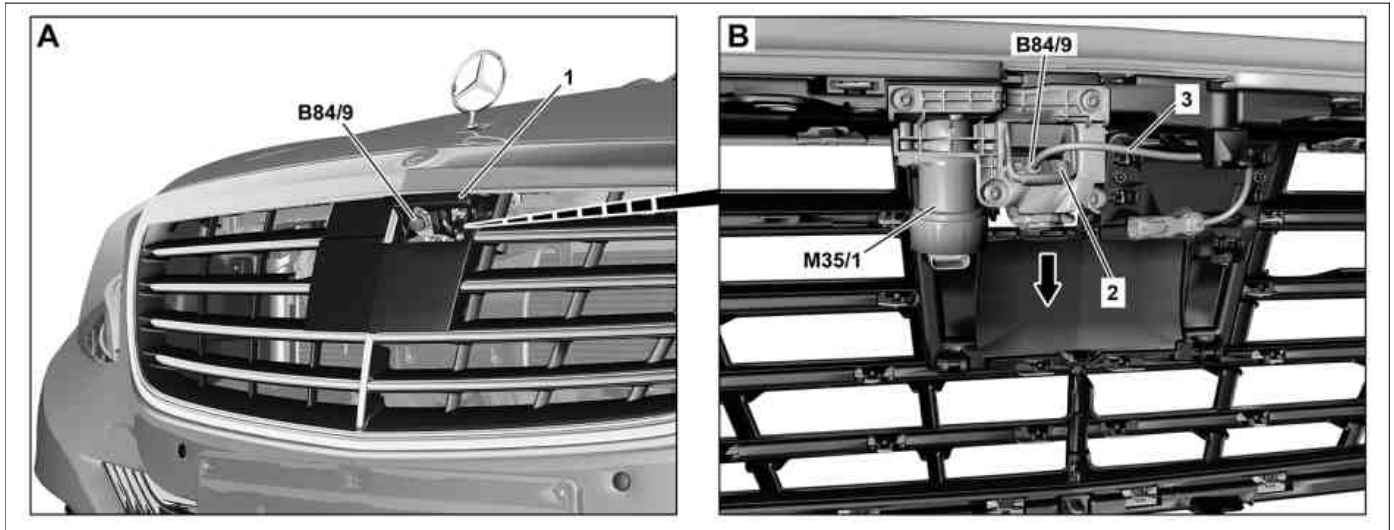

P54.33-2819-08

- |   |                   |       |                           |
|---|-------------------|-------|---------------------------|
| 1 | Camera cover flap | 3     | Electrical wiring harness |
| 2 | Retaining clip    | B84/9 | Front 360° camera         |

|     |  |  |                    |
|-----|--|--|--------------------|
| ⓘ   | Information on preventing damage to electronic components due to electrostatic discharge |  | AH54.00-P-0001-01A |
| ⊞ ⊞ | <b>Remove/install</b>  |  |                    |
| 1   | Remove radiator grille   |  | AR88.40-P-4001LF   |
| 2   | Open camera cover flap (1) and push retaining clip (2) out (arrow)                       |  |                    |
| 3   | Unclip electrical wiring harness (3)   |  |                    |
| 4   | Pull front 360° camera (B84/9) out of radiator trim                                      |  |                    |
| 5   | Install in the reverse order   |  |                    |
| 6   | Commission front 360° camera (B84/9) using diagnostic system                             | If the front 360° camera (B84/9) was replaced. | AD00.00-P-2000-04B |
| AD  | Calibrate front 360° camera (B84/9) using diagnostic system                              |  | AD00.00-P-2000-04B |