



Model 217, 222.0/1/9  
up to model year 2018

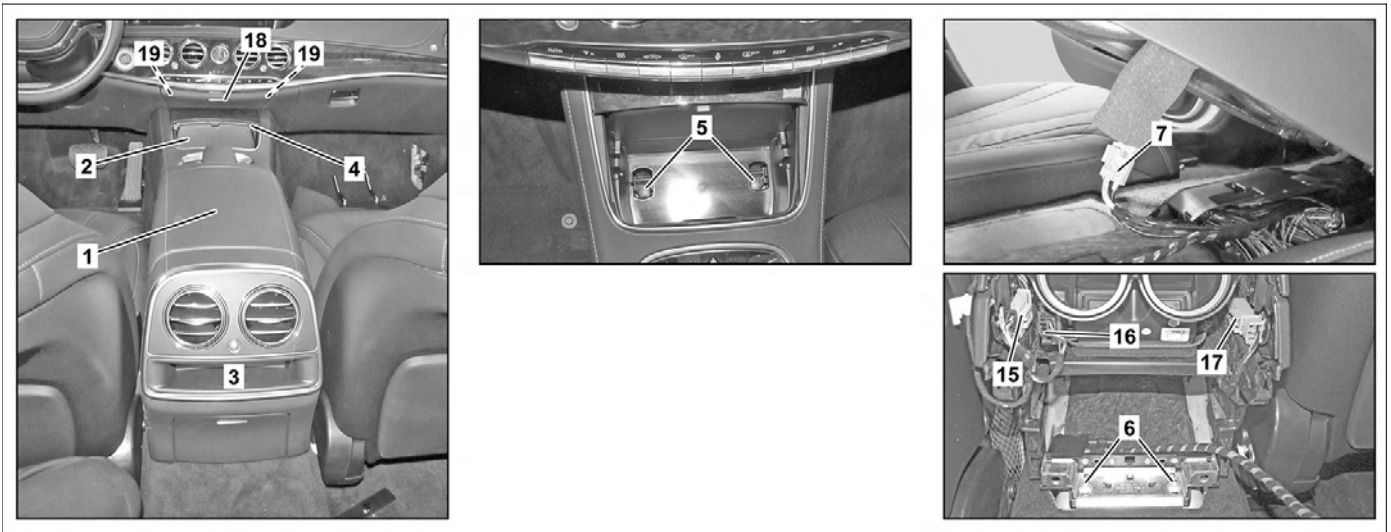

P68.20-4645-08

Shown on model 222 up to model year 2018 except code 582 (Air conditioning system in rear)

- |   |                     |    |                      |
|---|---------------------|----|----------------------|
| 1 | Center console      | 7  | Electrical connector |
| 2 | Stowage compartment | 15 | Electrical connector |
| 3 | Cover               | 16 | Electrical connector |
| 4 | Cover               | 17 | Electrical connector |
| 5 | Bolts               | 18 | Stowage compartment  |
| 6 | Bolts               | 19 | Screw                |

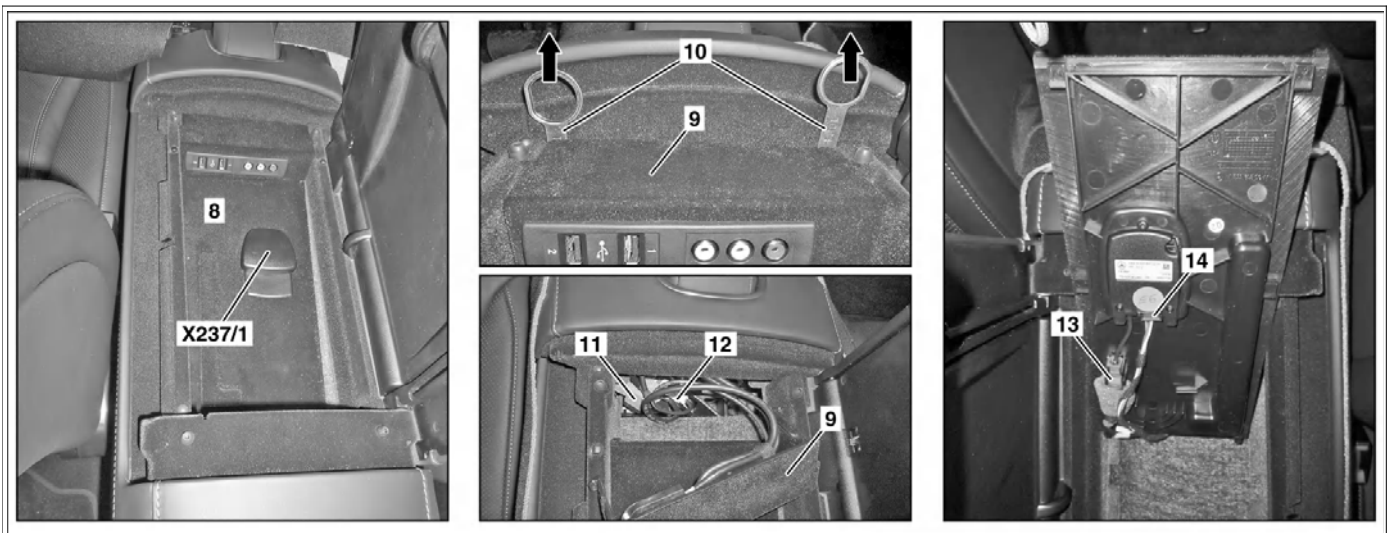


P68.20-4646-08

Shown on model 222 up to model year 2018 with code 386 (Convenience telephony) and code 582 (Air conditioning system in rear)

- 8 Cover




Shown on MODEL 222.1 with code 224 (Design individual rear seat system)

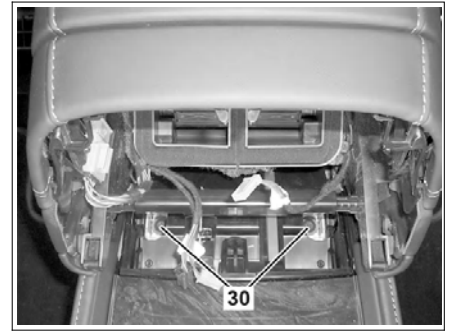30 Bolts



P68.20-4857-01

	Notes on avoiding damage to optical fibers during repair work		AH82.60-P-0001-05AK
	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
☒ ☒	<b>Remove/install</b>		
1	Open stowage compartment (2)		
2	Remove rubber insert from stowage compartment (2)		
3	Remove bolts (5)		
4	Remove cover (3) from center console (1)		AR68.20-P-2350LF
5	Remove cup holder in rear	Model 222.1/9 up to model year 2018 with code 224 (Rear individual seat design)	AR68.00-P-5204LF
6	Remove rear entertainment unit (A26/18)	Model 222 up to model year 2018 with code P46 (Rear-Seat Entertainment Package) except code 224 (Rear individual seat design)	AR82.60-P-7697LF
7	Remove screws and remove bracket of rear seat entertainment system control unit (A26/18)	Model 222.0/1/9 up to model year 2018 with code P46 (Rear-Seat Entertainment Package) except code 224 (Rear individual seat design)	
8	Disconnect electrical connectors (15, 16, 17)		
9	Open cover of center console (1) armrest		
10	Remove multimedia connection unit in front stowage compartment		AR82.60-P-1032LF
11	Remove cover (8)	Model 217, 222 up to model year 2018 with code 386 (Comfort telephony) Model 222 up to model year 2018 with code 856 (Business telephony in rear passenger compartment) except code 224 (Rear individual seat design)	
12	Remove soft top operation switch	Model 217.4 up to model year 2018	AR77.39-P-1000LCA
13	Remove bolts (6)		
14	Remove screws (30)	Model 217 up to model year 2018 Model 222.1/9 up to model year 2018 with code 224 (Rear individual seat design)	
15	Open stowage compartment (18) in instrument panel		
16	Remove screws/bolts (19)		
17	Disconnect electrical connector in stowage compartment (18) and remove stowage compartment (18)		
18	Lift center console (1)	<p><b>i</b> Press cross strut down on center console (1) below stowage compartment in instrument panel. The cover (4) falls off the COMAND control unit (A40/3) when the center console(1) is lifted.</p> <p><b>i</b> <b>Installation:</b> Clip molding (4) into COMAND control unit (A40/3).</p>	

		 Helper required.	
19	Disconnect electrical connector (7)	Model 217 up to model year 2018 Model 222.0/1/9 up to model year 2018 except code 582 (Rear air conditioner)	
20	Disconnect electrical connector on touchpad on center console (1)	Model 217, 222.0/1 up to model year 2018 with code 318 (Touchpad with rotary pushbutton) Model 222.9 up to model year 2018 with code 448 (Touchpad)	
21	Disconnect electrical connectors under center console (1)	 The number of electrical connectors varies according to vehicle equipment.	
22	Remove center console (1) toward rear from vehicle	 Helper required.	
23	Install in the reverse order		