


2018 Mercedes Benz E63S AMG 4MATIC Sed (213.089) V8-4.0L Turbo (177.980)

Vehicle > Technical Service Bulletins

CHECK CAMSHAFT COVER, ADJUST IF NECESSARY MODELS 172, 205, 213, 253 MODEL YEAR 2018

Service Campaign Bulletin


Mercedes-Benz

Campaign No. 2017100008, November 2017

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Check Camshaft Cover, Adjust if Necessary
Models 172, 205, 213, 253 model year 2018**

Daimler AG ('DAG'), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY18 172, 205, 213, 253, (SLK-Class, C-Class, E-Class, GLC-Class) vehicles, the camshaft cover may not have been correctly installed. As a result, small amounts of oil may leak from the camshaft cover. An authorized Mercedes-Benz dealership will check the camshaft cover and adjust, if necessary.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 2442 vehicles are affected.

Order No. P-SC-2017100008
This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

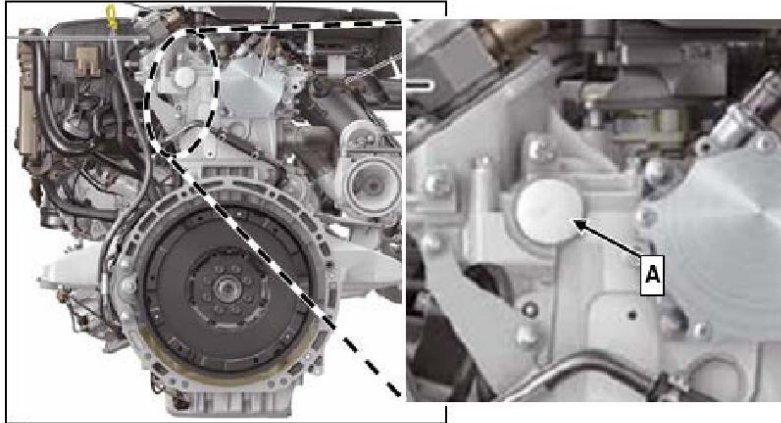
<https://my.alldata.com/repair/#/repair/vehicle/58526/component/1/itype/100/tsbs/20180213145530028/selfRefLink/>

1/3

Procedure

1. Open hood and check cover (A, figure 1) of camshaft.

i The cover **must** be flush **all-round** in the cylinder head housing.
If necessary, press on cover again using a suitable plastic wedge (1, figure 2).
The replacement of the cover is **not** required!


**Figure 1****Figure 2**

P-SC-2017100008

Warranty Information

Operation: Check camshaft cover, adjust if necessary (02-2062)

Damage Code	Operation Number	Labor Time (hrs.)
05 900 35 8	02-2062	0.1

 **Note**
Operation Number labor times are subject to change.

P-SC-2017100008