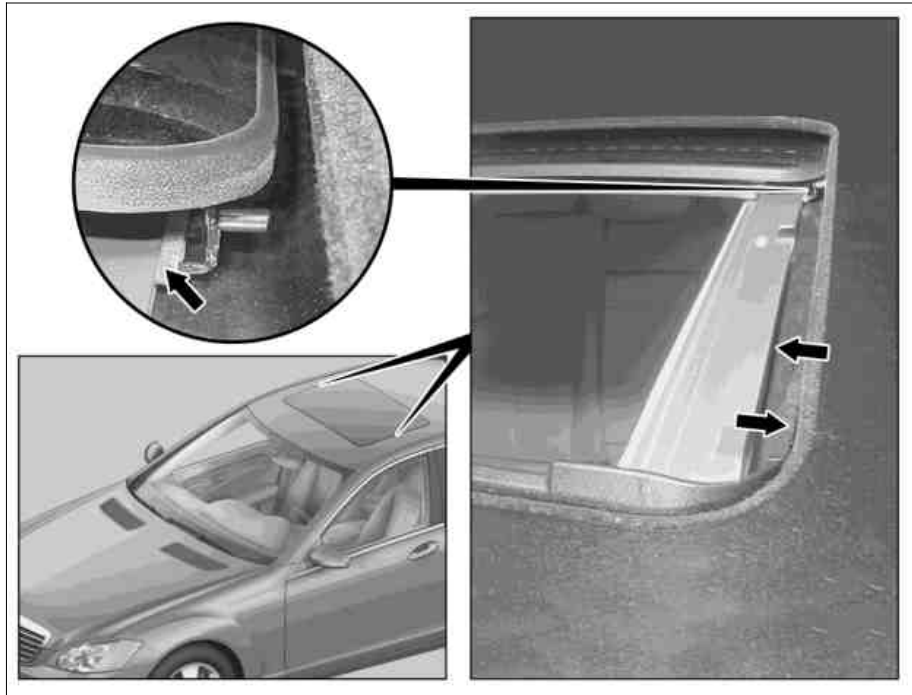**MODEL   216, 221.0 with CODE (414) Power glass tilting/sliding roof**
MODEL   221.1 except CODE (413) Panoramic glass roof with top sliding roof

P77.20-2562-06

🖐	**Clean**		
⚠ **Danger!**	**Risk of injury** caused by **fingers being pinched or crushed** when removing, installing or aligning hoods, doors, trunk lids, liftgates or sliding roof	Keep body parts and limbs well clear of moving parts.	AS00.00-Z-0011-01A
1	Switch on ignition and open tilting/sliding roof fully		
2	Clean slide rails and sliding blocks (arrows) with rag		
3	Coat sliding rails and sliding blocks (arrows) thinly with grease	Klueber Polylub GLY 801 grease	*BR00.45-Z-1046-06A
4	Check tilting/sliding roof for proper function		
5	Close tilting/sliding roof and switch off ignition		

Repair materials

Number	Designation	Order number
BR00.45-Z-1046-06A	Klueber Polylub GLY 801 grease	A 001 989 84 51