

MODEL 211.2 up to 31.5.06

with CODE (521) MB Audio 50 radio USA (without navigation)

with CODE (525) MB Audio 50 APS radio


with CODE (526) COMAND (without navigation)

with CODE (527) COMAND APS (with navigation)

with CODE (528) HIGH Class USA

with CODE (529) HIGH Class Japan

with CODE (530) COMAND APS USA (with navigation system)

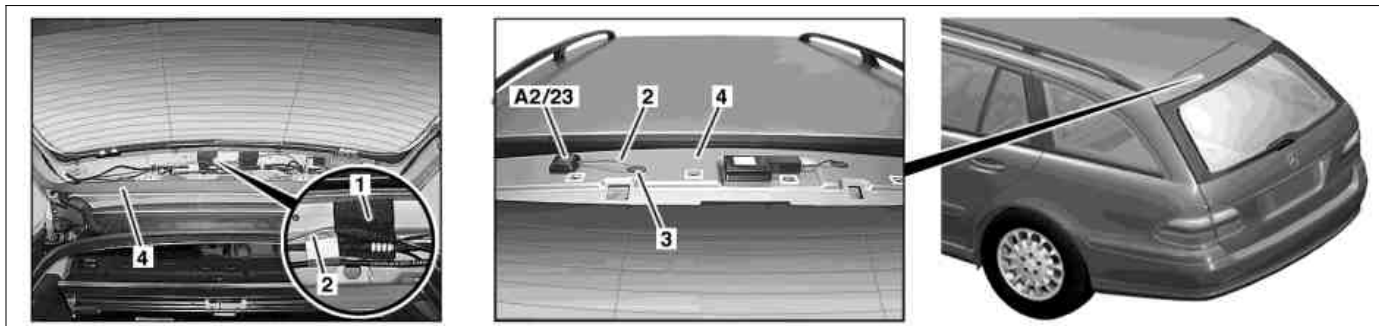








P82.85-9787-07

1 Self-adhesive felt
2 Antenna line

3 Grommet
4 Rear-end door

A2/23 GPS antenna

 	Remove/install		
	Notes on avoiding damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Remove rear spoiler		AR72.20-P-4000T
2	Detach self-adhesive felt (1) and separate electrical connector of antenna line (2) underneath		
3	Remove grommet (3) from rear-end door (4)	 Installation: Use liquid lubricant. Antifriction agent	*BR00.45-Z-1010-06A
4	Route antenna line (2) through rear-end door (4)		
5	Use assembly wedge to detach GPS antenna (A2/23) from rear-end door (4) and remove	 Always replace GPS antenna (A2/23).  Installation: Clean and degrease mounting location on rear-end door (4).	*110589035900
6	Install in the reverse order		

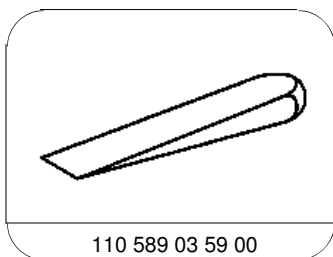

110 589 03 59 00

Wedge tool

Repair materials

Number	Designation	Order number
BR00.45-Z-1010-06A	Antifriction agent	A 000 989 03 67