



- 1 Top molding
- 2 Bottom molding
- 3 Rear side window
- 4 Upper mounting clips
- 5 Bottom mounting clips

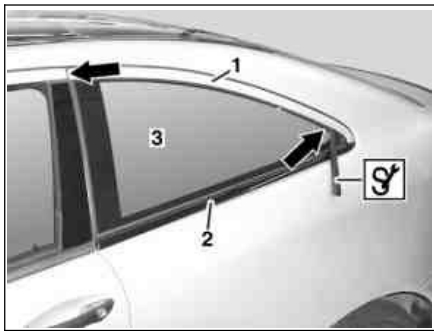


P67.30-2057-01

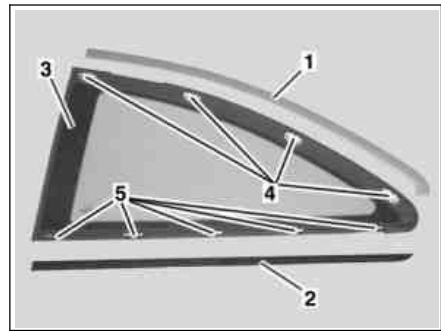

P67.30-2058-01

	Removal		
1	Unclip top molding (1)	Assembly wedge Start at front at the first three mounting clips (4)	*1 10589035900
2	Move top molding (1) toward front	This loosens the top molding (1) on the last mounting clip.	
3	Remove top molding (1)		
4	Unclip bottom molding (2)	Assembly wedge	*1 10589035900
5	Remove bottom molding (2)		
	Installing		
6	Check mounting clips (4) and (5)	Replace damaged mounting clips (4) and (5).	
7	Align top molding (1) at mounting clips (4) and press on	Use lubricant	*BR00.45-Z-1010-06A
8	Align bottom molding (2) at mounting clips (5) and press on		
9	Check molding (1) and (2) position, correct if necessary.		

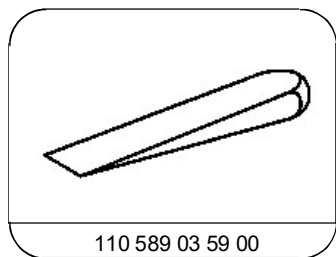

110 589 03 59 00

Assembly wedge

Repair materials

Number	Designation	Order number
BR00.45-Z-1010-06A	Lubricant, rubber assembly 1 l	A 000 989 03 67