Mercedes 7/9/9/6

(1) 68942-10K





- Converter apply & release complaints
- Converter codes
- Lube failures

Note: Requires tool kit F-68942-TL10 & the VB-FIX reaming fixture.


(2) 68942-23K

TCC Damper Valve & Sleeve Kit

Helps cure:

Harsh lockup







- Reduced line pressure
- Delayed engagements

Note: Requires tool kit F-68942-TL16 & the VB-FIX reaming fixture.

(4) 68942-07K



Pressure Regulator Valve Kit

Helps cure:

- Loss of 2-3, 4-3 neutral
- Soft shifts under acceleration

Note: Requires tool kit F-68942-TL7 & the VB-FIX reaming fixture.

(5) 68942-06



Outer Pressure Regulator Sleeve

Repairs outer bore only


Helps cure:

- Loss of 2-3, 4-3 neutral
- Soft shifts under acceleration

Note: Requires tool kit F-68942-TL6 & the VB-FIX reaming fixture.



1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

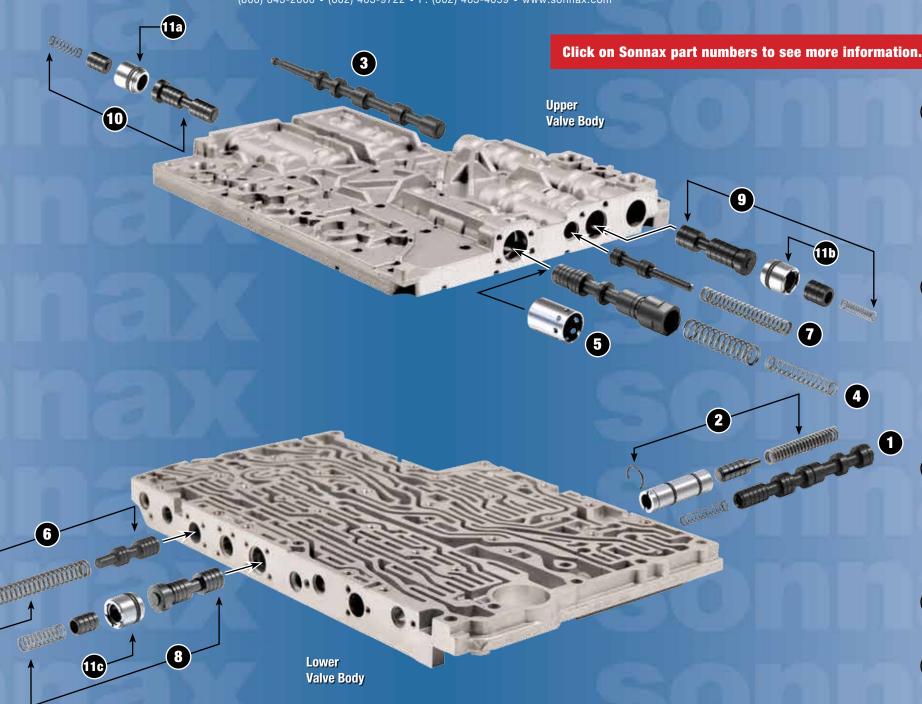

68942-17K



Oversized Regulating Valve Pressure Control Valve Kit

Early & Late Units

Helps cure:

- Delayed engagements
- Upshift/Downshift flares

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.

©2014 Sonnax Industries, Inc

he Sonnax products listed here may be protected by one or more patents, or be patent pending

(7) 68942-14K



Helps cure:

- Delayed engagement
- Poor performance/higher stall speeds

Note: Requires tool kit F-68942-TL14 & the VB-FIX reaming fixture.

(8) 68942-19K





Control Valve Kit Helps cure:

- Harsh/Flare/Cycling of 1-2/4-5 shifts
- Slipping Gears

1-2, 4-5 Overlap

Note: Requires tool kit F-68942-TL19 & the VB-FIX reaming fixture.

68942-27K



2-3 Overlap Control Valve Kit

Helps cure:

- Harsh/Bumpy/Flare 2-3 shifts
- Slipping gears

Note: Requires tool kit F-68942-TL27 & the VB-FIX reaming fixture.

(10) 68942-31K





- Harsh/Bumpy/Flare 3-4 shifts
- Slipping gears

Note: Requires tool kit F-68942-TL31 & the VB-FIX reaming fixture.

This kit fits 3 locations! 68942-05K (Also sold separately)

Master Overlap Control Valve Sleeve Kit

Helps cure:

- Harsh/Bumpy/Flare shifts
- Slipping gears

(11a) 68942-04

3-4 Overlap Control Sleeve

(11b) 68942-03

2-3 Overlap Control Sleeve

(11c) 68942-02 Fits 1 location

1-2, 4-5 Overlap Control Sleeve

(12) 68942-01

Solenoid Pressure Regulator Spring

'99-Earlier Units

Fits 1 location

Fits 1 location

Helps cure:

- Delayed engagements
- Flare 2-3, 3-4 or 4-5 shifts