

MODEL 245.2## 1# up to 1.6.08
 except CODE (809) Model year 2009
 with CODE (520) Audio 5 CD radio
 with CODE (533) Front and rear speakers -without radio-

A2 Radio



P82.60-5113-11

**Actual installation position shown on vehicle
 without code (580) Automatic air conditioning and
 without code (581) Comfort automatic air conditioning**


- N18 HEAT [HAU] control and operating unit (for vehicles without code (580) Automatic air conditioning and without code (581) Comfort automatic air conditioning)
- N22 AAC [KLA] control and operating unit (for vehicles with code (580) Automatic air conditioning)
- N22/7 Comfort AAC control and operating unit (for vehicles with code (581) Comfort automatic air conditioning)



P82.60-4751-11

**Specified installation position shown on vehicle
 without code (580) Automatic air conditioning and
 without code (581) Comfort automatic air conditioning**

- N18 HEAT [HAU] control and operating unit (for vehicles without code (580) Automatic air conditioning and without code (581) Comfort automatic air conditioning)
- N22 AAC [KLA] control and operating unit (for vehicles with code (580) Automatic air conditioning)
- N22/7 Comfort AAC control and operating unit (for vehicles with code (581) Comfort automatic air conditioning)

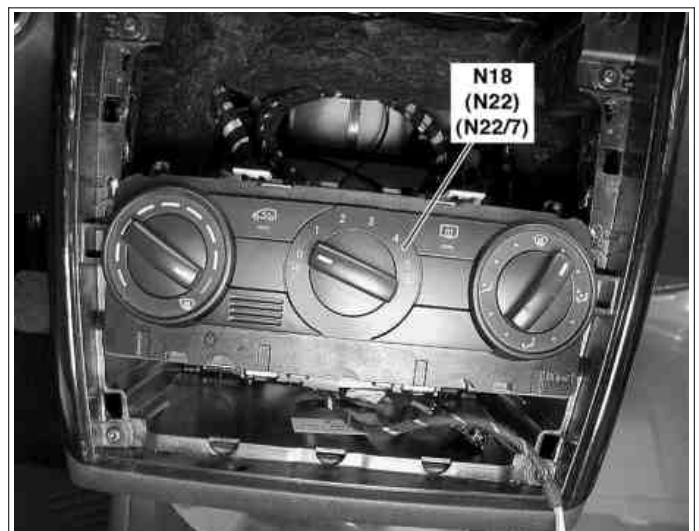

P82.60-4752-11



P82.60-5409-07

Vehicles with code (533) Front and rear speakers -without radio-

- 1 Cover (if installed)
2 Accessory radio (if installed)

- 3 Radio recess cover
4 Radio recess

☒	Removing		
i	Notes on radio installation		AH82.60-P-0001-03AK
1	Switch off all electrical consumers, switch off ignition and remove transmitter key from EIS [EZS] control unit		
2	Remove cover for HEAT [HAU] control and operating unit (N18) or AAC [KLA] control and operating unit (N22) or comfort AAC control and operating unit (N22/7)	i Once removed the cover can no longer be used and must be replaced by a new one.	AR68.20-P-2314AK
3	Remove center air vent		AR83.10-P-4503AK
4.1	Remove Audio 5 CD radio (A2)	For vehicles with code (520) Audio 5 CD radio i The Audio 5 CD radio (A2) is no longer required.	AR82.60-P-7502AK
4.2	Remove radio accessories (2)	For vehicles with code (533) Front and rear speakers - without radio - and with an accessory radio (2). i The radio accessories (2) must be handed over to the customer.	
4.3	Remove cover (1) over radio recess cover (3)	On vehicles with code (533) Font and rear speaker -without radio- i Covering (1) no longer needed.	
5	Remove radio recess cover (3)	On vehicles with code (533) Font and rear speaker -without radio- i The radio recess cover (3) is no longer required. The four bolts are necessary to fasten the new Audio 20 CD radio (A2) into place.	
6	Remove radio recess (4)	On vehicles with code (533) Font and rear speaker -without radio- i The radio recess (4) is no longer required.	
7	Remove cover below right dashboard	On vehicles with code (533) Font and rear speaker -without radio-	AR68.10-P-1520AK
8	Remove HEAT [HAU] control and operating unit (N18), AAC [KLA] control and operating unit (N22) or comfort AAC control and operating unit (N22/7)	i Do not disconnect electrical connectors or Bowden cables. On vehicles without code (580) automatic air conditioning and without code (581) convenience automatic air conditioning On vehicles with code (580) Automatic air conditioning On vehicles with code (581) Comfort automatic air conditioning	AR83.25-P-1125AK AR83.40-P-6350AK AR83.40-P-6350AL
☒	Install		
9	Install HEAT [HAU] control and operating unit (N18) or AAC [KLA] control and operating unit (N22) or comfort AAC control and operating unit (N22/7) one level down.	On vehicles without code (580) automatic air conditioning and without code (581) convenience automatic air conditioning On vehicles with code (580) Automatic air conditioning On vehicles with code (581) Comfort automatic air conditioning	AR83.25-P-1125AK AR83.40-P-6350AK AR83.40-P-6350AL

10	Retrofit Controller Area Network (data bus/ CAN Bus) (CAN) wiring harness	On vehicles with code (533) Front and rear speaker -without radio- For vehicles with code (520) Audio 5 CD radio	AN82.61-P-0001-01BKA AN82.61-P-0001-01AKB
11	Retrofit AUX socket	Only on customer request.	AN82.60-P-0008BK
12	Install Audio 20 CD radio (A2)		AR82.60-P-7502AK
13	Assemble vehicle	i Steps 7, 3 and 2.	
14	Connect STAR DIAGNOSIS		AD00.00-P-2000-04A
15	Enter special equipment on the vehicle data card and the online vehicle data card	i Enter code (523) MB Audio 20 radio and code (533) Front and rear speakers -without radio- and delete code (520) Audio 5 CD radio.	
16	Subsequently perform variant coding with STAR DIAGNOSIS	i Register the new system and, if necessary, reconfigure the Media Oriented System Transport (MOST) ring.	
17	Close STAR DIAGNOSIS		AD00.00-P-2000-04A
18	Perform function check on Audio 20 CD radio (A2)	i Refer to Audio 20 CD radio (A2) operator's manual.	

Parts ordering notes

Part no.	Designation	Quantity
DG 99 (see EPC)	Scope of delivery for MB Audio 20 CD radio	1
	On customer request only.	
DG 99 (see EPC)	Wiring harness for AUX socket	1