


MODEL 197, 211, 216, 219, 221, 230

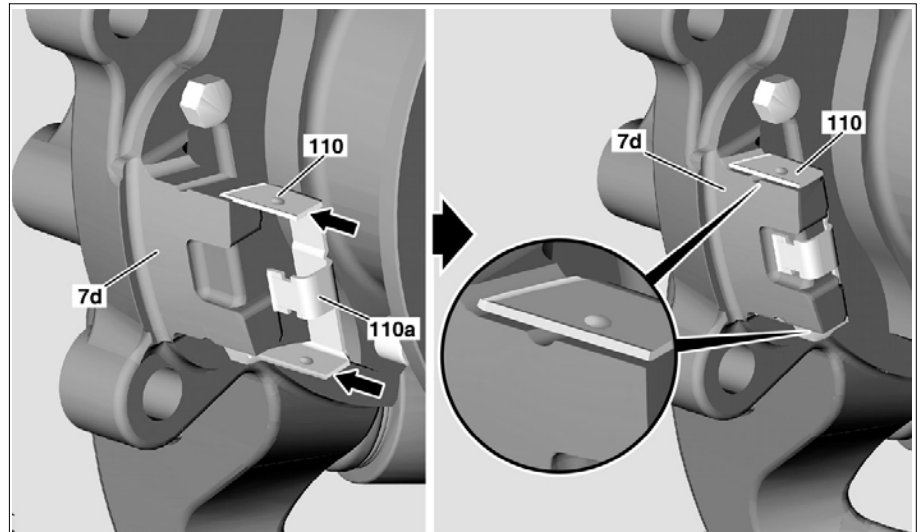

P42.20-2124-05

Slide 1 cap (110) using suitable tool onto brake stator (7d).

i The depressions in the cap must latch in the grooves of the brake stator.

! The force to install the cap (110) must only be applied to the front side of the mounting tabs (arrows). Do not apply any force to the mounting frame bow (110a).

This is because the cap (110) will be distorted thereby impairing the clamping effect allowing it to wander during vehicle operation, this in turn leads to noise development and the brake system heating up.