
MODEL 219.3

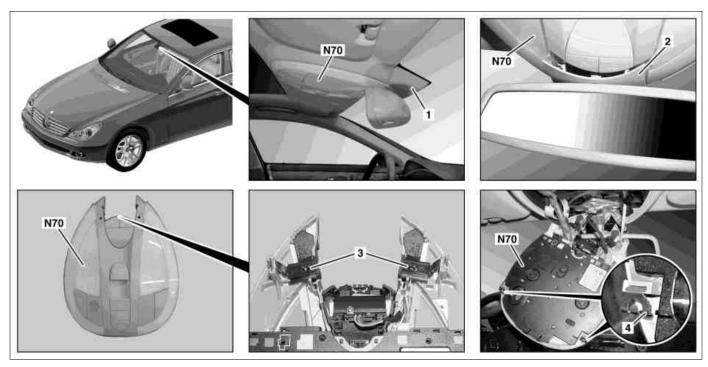

P82.20-2728-09

- 1 Rain/light sensor cover
- 2 Mirror base cover

3 Pushbuttons4 Retaining springs


N70 Overhead control panel control unit

Modification notes

17.10.05	Disconnect ground line of battery, removed	Step 2	
----------	--	--------	--

XX	Remove/install		
(3)	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1.1 ⊶••••••••••••••••••••••••••••••••••••	Transfer basic data from overhead control panel control unit (N70) to STAR DIAGNOSIS Connect STAR DIAGNOSIS and read out	When installing new overhead control panel control unit (N70). i Installation: Transfer buffered basic data to new overhead control panel control unit (N70), and for code (414) Tilting/sliding roof, normalize the anti-pinch protection.	AD00.00-P-2000-04A
	fault memory	STAR DIAGNOSIS diagnosis system	*WH58.30-Z-1048-13A
2.1	Switch off the ignition and remove the transmitter key from the EIS control unit	On vehicles without code (889) Keyless Go	
2.2	Switch off ignition and place transmitter key out of transmission range of vehicle	On vehicles with code (889) Keyless Go	
3	Use long wedge to pry off rain/light sensor covering (1) downward and remove	3	*115589035900
4	Use long wedge to unclip mirror base cover (2) from overhead control panel control unit (N70)	3	*115589035900
5	Release overhead control panel control unit (N70) at front by pressing pushbuttons (3)		
6	Use mounting wedge to unclip overhead control panel control unit (N70) at retaining springs (4) from headliner	Unclip carefully. Risk of damaging headliner.	*110589035900
7	Remove overhead control panel control unit (N70) far enough from headliner until the electrical connectors are accessible on the rear of the overhead control panel control unit (N70)		110309033900
8	Detach electrical connectors from overhead	i The number of electrical connectors is	

		i Installation: Ensure that electric wiring harness is routed properly.	
9	Install in the reverse order		
10.1	Normalize tilting/sliding roof	i For vehicles with code (414) Tilting/ sliding roof	
11 A D	Read fault memory, erase if necessary Connect STAR DIAGNOSIS and read out fault memory		AD00.00-P-2000-04A
		STAR DIAGNOSIS diagnosis system	*WH58.30-Z-1048-13A

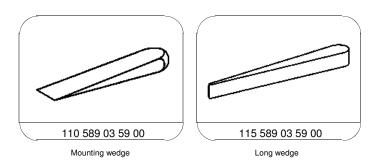

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00