MODEL 204 MODEL 207.3

as of model year 2014

without CODE 427 (7G-TRONIC)

MODEL 207.3

up to model year 2014


MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277)

without CODE 279 (Electronic gear selector)


MODEL 212.074/077/274/277

Shown on center console (1) on MODEL 204.0 up to 28.02.2011 with CODE 386 (Comfort telephony)

- 1 Center console
- 3 Cover
- 5 Stowage tray (without CODE 301
- (Smoker package))
 6 Armrest
- 7 Waste receptacle
- 11 Cover
- 13 Roller blind (on model 204.0/2/3,
 - 207.3, 212)
- 18 Cover (without CODE 301
 - (Smoker package))
- 20 Rear air vent
- 24 Mounting console (on MODEL
 - 204.0/2/3, 207.3, 212 with CODE 386 (Comfort telephony))
- A34/7 Bluetooth module (with CODE
- (386) (Comfort telephony))
- A40/9 Audio/COMAND control panel

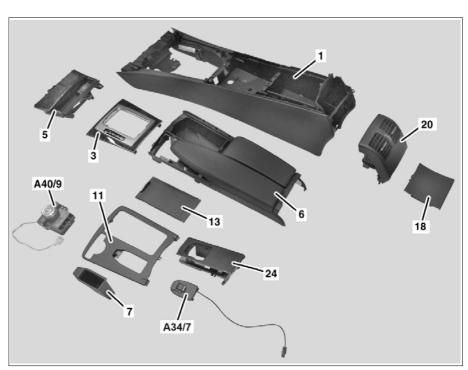

P68.20-4126-06

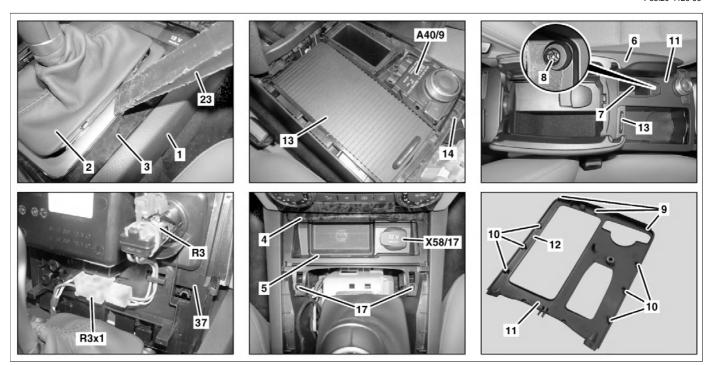


P68.20-3704-09

Shown on center console (1) on MODEL 204.0 with CODE 386 (Comfort telephony)

2	Boot	13	Roller blind (on model 204.0/2/3, 207.3, 212)
3	Cover	14	Screw
4	Cover	17	Bolts
5	Stowage tray (without CODE 301 (Smoker package))	23	Assembly wedge
6	Armrest	37	Front ashtray (with CODE 301 (Smoker package))
7	Waste receptacle	A40/9	Audio/COMAND control panel
8	Screw	R3	Cigarette lighter with front ashtray illumination (with code 301 (Ashtray package/smoker package))
9	Front catch hook	R3x1	Electrical connector for front cigarette lighter with ashtray illumination (with code (301) Ashtray/smoker package)
10	Side catch hook	X58/17	Front vehicle interior socket (without CODE 301 (Smoker package))
11	Cover		. ,


Shown on model 204.0


- 1 Center console
- 15 Electrical connector
- 16 Electrical connector
- 34 Electrical line

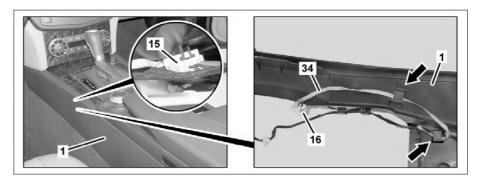



P68.20-3795-04




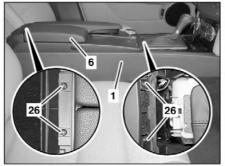

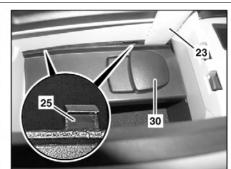

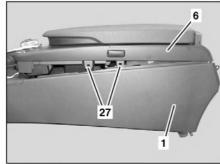

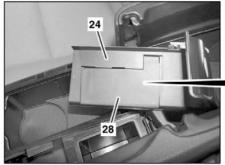

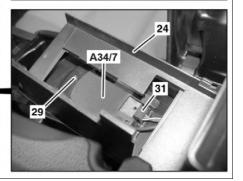

P68.20-4127-09


Shown on MODEL 204.0 up to 28.02.2011 with CODE 386 (Comfort telephony)

1	Center console	26	Bolts	31	Electrical connector (on MODEL 204.0/2, 207.3 up to 28.02.2011, 212 with CODE 386 (Comfort telephony))
6	Armrest	27	Lugs	A34/7	Bluetooth module (with CODE 386 (Comfort telephony))
23	Assembly wedge	28	Flap (on MODEL 204.0/2, 207.3 up to 28.02.2011, 212 with CODE 386 (Comfort telephony))	X39/37	Electrical connector for mobile phone (with CODE 386 (Comfort telephony))
24	Mounting console (on MODEL 204.0/2, 207.3 up to 28.02.2011, 212 with CODE 386 (Comfort telephony))	29	Bolt (on MODEL 204.0/2, 207.3 up to 28.02.2011, 212 with CODE 386 (Comfort telephony))		
25	Catch hook (on MODEL 204.0/2/3, 207.3, 212 with CODE 386 (Comfort telephony))	30	Cover (on MODEL 204.0/2, 207.3, 212 with CODE 386 (Comfort telephony))		

Shown on MODEL 207.3 as of 01.03.2011 with CODE 386 Comfort telephony and CODE 512 (COMAND APS incl. DVD changer)

X39/37 Electrical connectors for mobile phone (with CODE 386 (Comfort telephony))
X115x1 Separation point for electrical connector USB (on MODEL 204 with CODE

512 (COMAND APS incl. DVD changer), MODEL 207.3 as of 01.07.11 up to model year 2014 with CODE 512 (COMAND APS incl. DVD changer) or CODE 526 (COMAND (without navigation)) or CODE 528 (COMAND incl. DVD changer) or CODE 527 (COMAND APS with single DVD drive (with navigation)), MODEL 207.3 as of 01.06.12 up to model year 2014 with CODE 510 (Audio 20 CD with CD changer) or CODE 523 (Radio MB Audio 20), MODEL 207.3 as of model year 2014)

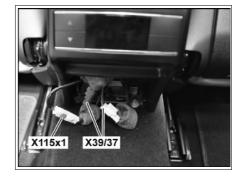

P82.70-7617-01


Shown on mounting console (36) on MODEL 204.9 with CODE 386 (Comfort telephony)

35 Bolt (with CODE 386 (Comfort telephony))

36 Mounting console (with CODE 386 (Comfort telephony))

38 Electrical connector (on MODEL 204.9 with CODE 386 (Comfort telephony))

A34/7 Bluetooth module (with CODE 386 (Comfort telephony))

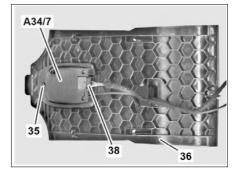


P68.20-4128-01

Shown on mounting console (39) on MODEL 207 with CODE 386 (Comfort telephony)

- 1 Center console
- 22 Electrical line

X115

- 23 Assembly wedge
- 25 Catch hook (on MODEL 204.0/2/3, 207.3, 212 with CODE 386 (Comfort telephony))
- 39 Mounting console (on MODEL 204.0/2, 207.3 as of 01.03.2011, MODEL 204.3 with CODE 386 (Comfort telephony))
- 40 Bolt (MODEL 204.0/2 as of 01.03.11, 204.3 with CODE 386 (Comfort telephony) or CODE 512 (COMAND APS incl. DVD changer) or CODE 518 (Media Interface), MODEL 207.3 as of 01.03.11 up to model year 2014 with CODE 386 (Comfort telephony) or CODE 512 (COMAND APS incl. DVD changer or CODE 518 (Media Interface), MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony))
- A34/7 Bluetooth module (with CODE 386 (Comfort telephony))

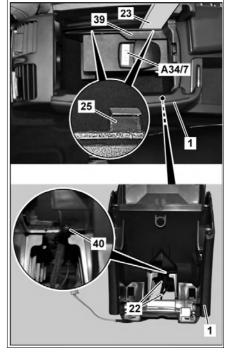


P82.70-7615-03

Shown on MODEL 207 as of 01.03.2011 up to model year 2014 without CODE 386 (Comfort telephony)

41 Connecting strip (on MODEL 204.0/2, 207.3 as of 01.03.2011 up to model year 2014, MODEL 204.3 without CODE 386 (Comfort telephony))

X18/70 Electrical connector for Media Interface (with CODE 518 (Media Interface))

(Media Interface))
Electrical connector for USB (on MODEL 204 with
CODE 512 (COMAND APS incl. DVD changer), MODEL
207.3 as of 01.07.11 up to model year 2014 with CODE
512 (COMAND APS incl. DVD changer) or CODE 526
(COMAND (without navigation)) or CODE 528 (COMAND
incl. DVD changer) or CODE 527 (COMAND APS with
single DVD drive (with navigation)), MODEL 207.3 as of
01.06.12 up to model year 2014 with CODE 510 (Audio
20 CD with CD changer) or CODE 523 (Radio MB
Audio 20), MODEL 207.3 as of model year 2014)

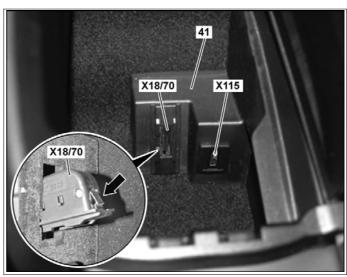

Page 3 of 10

(1)	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
£ ,£	Disassemble/assemble		
1	Switch off ignition and remove transmitter key		
2	Unclip boot (2) from cover (3) with assembly wedge (23)	Mounting wedge	*110589035900
3	Position selector lever or gearshift lever to neutral or position "N" depending on equipment	MODEL 204 MODEL 207.3 as of model year 2014 without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 279 (Electronic gear selector)	
4	Open cover (4)		
5	Unclip cover (3) upward in front area, disconnect electrical connector and remove cover (3)		
6	Open armrest (6) and take out waste receptacle (7)		
7	Unscrew bolt (8)		
8	First unclip front catch hooks (9), then side catch hooks (10) and remove cover (11) from center console (1)	Carefully unclip cover (11). Otherwise the stay (12) on the cover (11) can break and the cover (11) must be replaced.	
9	Pull roller blind (13) toward front out of armrest (6)	MODEL 204 (except 204.9) MODEL 207.3 as of model year 2014 without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277	
10	Unscrew screw/bolt (14)		
11	Loosen center console (1) until electrical line (34) is accessible on the underside of center console (1)	MODEL 204 MODEL 207.3 as of model year 2014 without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277	AR68.20-P-2000CW AR68.20-P-2000EW
12	Disconnect electrical connector (15)	Only when removing audio/COMAND operating unit (A40/9) completely.	
13	Unclip electrical connector (16) from center console (1), unhook electrical line (34) from guides (arrows) and remove Audio/COMAND control unit (A40/9)	Only when removing audio/COMAND operating unit (A40/9) completely.	
14.1	Unscrew bolts (17) and remove stowage tray (5) until electrical connector on front vehicle interior socket (X58/17) is accessible	MODEL 204 without CODE 301 (Package SMOKER) MODEL 207.3 as of model year 2014 without CODE 301 (Package SMOKER) without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 without CODE 301 (Package SMOKER) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 301 (Package SMOKER) MODEL 212.074/077/274/277 without CODE 301 (Package SMOKER) MODEL 212.074/077/274/277 without CODE 301 (Package SMOKER)	

14.2	Unscrew bolts (17) and remove ashtray (37) until electrical connector on the cigarette lighter with front ashtray illumination (R3x1) is	MODEL 204 with CODE 301 (Package SMOKER) MODEL 207.3	
	accessible	as of model year 2014 with CODE 301 (Package SMOKER) without CODE 427 (7G-TRONIC) MODEL 207.3	
		up to model year 2014 with CODE 301 (Package SMOKER) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) with CODE 301 (Package SMOKER)	
		with CODE 301 (Flackage SMOKER) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 301 (Package SMOKER)	
15.1	Disconnect electrical connector from front vehicle interior socket (X5817) and remove stowage tray (5)	MODEL 204 without CODE 301 (Package SMOKER) MODEL 207.3 as of model year 2014 without CODE 301 (Package SMOKER)	
		without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 without CODE 301 (Package SMOKER)	
		MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 279 (Electronic gear selector) without CODE 301 (Package SMOKER) MODEL 212.074/077/274/277	
15.0	Disconnect electrical connector on signs the	without CODE 301 (Package SMOKER)	
15.2	Disconnect electrical connector on cigarette lighter with front ashtray illumination (R3x1) from cigarette lighter with front ashtray illumination (R3) and remove front ashtray (37)	MODEL 204 with CODE 301 (Package SMOKER) MODEL 207.3 as of model year 2014	
		with CODE 301 (Package SMOKER) without CODE 427 (7G-TRONIC) MODEL 207.3	
		up to model year 2014 with CODE 301 (Package SMOKER) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277)	
		with CODE 301 (Package SMOKER) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 301 (Package SMOKER)	
16	Remove rear air vent (20)	MODEL 204 MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277	AR83.10-P-4800CW
		MODEL 207.3 as of model year 2014 without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014	AR83.10-P-4800EC
17.1	Remove rear ashtray	MODEL 204 with CODE 301 (Package SMOKER) MODEL 207.3 as of model year 2014 with CODE 301 (Package SMOKER)	
		without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 with CODE 301 (Package SMOKER)	
17.0	<u> </u>		AR68.20-P-2230CW
17.2	Remove rear ashtray or stowage compartment	MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277	
		i Removal of the stowage compartment corresponds to removal of the rear ashtray.	AR68.20-P-2230EW
17.3	Remove cover (18)	MODEL 204 without CODE 301 (Package SMOKER) MODEL 207.3 as of model year 2014	
		without CODE 301 (Package SMOKER) without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014	
		without CODE 301 (Package SMOKER)	


18	Unscrew bolts (26) from armrest mount	(15) A	
10	Onsciew boils (20) from armiest mount	Assembly: Carefully tighten bolts (26).	
		Otherwise the center console (1) can be damaged and must be replaced.	
		i MODEL 204.0/2, MODEL 207.3 up to	
		28.02.11, MODEL 212 with CODE 386 (Comfort telephony)	
		It is not necessary to remove the armrest (6) to	
		completely remove the mounting console (24) or bluetooth module (A34/7).	
		i MODEL 204.0/2 as of 3/1/11	
		MODEL 204.3 with CODE 386 (Comfort telephony)	
		Remove armrest (6) to remove mounting	
19	Unclip armrest (6) on lugs (27) on left and	console (24).	
	right side of center console (1) and move out	Carefully unclip armrest (6).	
	toward rear	Otherwise the lugs (27) can break off.	
		MODEL 204.0/2 bis 28.02.11, MODEL 204.3 with CODE 386 (Comfort telephony),	
		MODEL 212 with CODE 386 (Comfort telephony)	
		It is not necessary to remove the armrest (6) to	
		completely remove the mounting console (24) or bluetooth module (A34/7).	
		i MODEL 204.0/2 as of 3/1/11	
		MODEL 204.3 with CODE 386 (Comfort telephony)	
		Remove armrest (6) to remove mounting	
		console (24). Mounting wedge	*110589035900
20	Disconnect mobile phone electrical connector	MODEL 204	
	(X39/37)	with CODE 386 (Comfort telephony) MODEL 207.3	
		as of model year 2014 with CODE 386 (Comfort telephony)	
		without CODE 427 (7G-TRONIC) MODEL 207.3	
		up to model year 2014 with CODE 386 (Comfort telephony)	
		MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277)	
		with CODE 386 (Comfort telephony)	
		without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277	
		with CODE 386 (Comfort telephony)	
21	Disconnect separating point for USB electrical connector (X115x1)	MODEL 204.0/2 as of 3/1/11 with CODE 512 (COMAND APS with DVD	
		changer) MODEL 204.3	
		with CODE 512 (COMAND APS with DVD	
		changer) MODEL 207.3 as of 6/1/12	
		up to model year 2014 with CODE 510 (Audio 20 CD with CD	
		changer)	
		MODEL 207.3 as of 6/1/12 up to model year 2014	
		with CODE 523 (MB Audio 20 radio)	
		MODEL 207.3 as of 7/1/11 up to model year 2014	
		with CODE 512 (COMAND APS with DVD changer)	
		MODEL 207.3 as of 7/1/11	
		up to model year 2014 with CODE 526 (COMAND with single DVD	
		drive (without navigation)) MODEL 207.3 as of 7/1/11	
		up to model year 2014	
		with CODE 528 (COMAND with DVD changer)	
		MODEL 207.3 as of model year 2014	
		without CODE 427 (7G-TRONIC) MODEL 207.3	
		up to model year 2014	
		with CODE 527 (COMAND APS with single DVD drive (with navigation))	
·	1	, , , , , , , , , , , , , , , , , , , ,	

22	Unclip Media Interface electrical connector (X18/70) and guide through opening in connector strip (41) or mounting console (39) toward rear	MODEL 204.0/2 as of 3/1/11 with CODE 512 (COMAND APS with DVD changer) MODEL 204.3 with CODE 512 (COMAND APS with DVD changer) MODEL 207.3 as of 6/1/12 up to model year 2014 with CODE 510 (Audio 20 CD with CD changer) MODEL 207.3 as of 6/1/12 up to model year 2014 with CODE 523 (MB Audio 20 radio) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 523 (MB Audio 20 radio) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 512 (COMAND APS with DVD changer) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 526 (COMAND with single DVD drive (without navigation)) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 528 (COMAND with DVD changer) MODEL 207.3 as of model year 2014 with CODE 527 (COMAND APS with single DVD drive (with navigation)) I Model 207.3 as of model year 2014 COnnector strip (41) eliminated. The electrical connector for Media Interface (X18/70) is clipped directly into the housing of the center console (1).	
23	Detach center console (1) in rear area until bolt (40) at the bottom of the center console (1) is easily accessible	MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 386 (Comfort telephony) MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 512 (COMAND APS with DVD changer) MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 518 (Media interface) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 512 (COMAND APS with DVD changer) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 518 (Media interface) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 518 (Media interface) MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony) without CODE 427 (7G-TRONIC)	AR68.20-P-2000CW
24	Unscrew bolt (40) at bottom of center console (1) on mounting console mount (39) or connecting strip (41) depending on equipment	MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 386 (Comfort telephony) MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 512 (COMAND APS with DVD changer) MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 518 (Media interface) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 512 (COMAND APS with DVD changer) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 518 (Media interface) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 518 (Media interface) MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony) without CODE 427 (7G-TRONIC) i Model 207.3 as of model year 2014 Connector strip (41) eliminated.	7 T T T T T T T T T T T T T T T T T T T

25.1	Unclip mounting console (39) with assembly wedge (23) from center console (1) and remove	MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 386 (Comfort telephony) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony) with CODE 386 (Comfort telephony) without CODE 427 (7G-TRONIC) (**) Carefully unclip mounting console (39). Otherwise the catch hooks (25) can break and the mounting console (39) must be replaced. I Guide electrical lines (22) with mobile phone electrical connector (X39/37) through opening in center console (1).	*110589035900
25.2	Unclip mounting console (24) with assembly wedge (23) and lay down to side in center console (1)	MODEL 204.0/2 up to 2/28/11 with CODE 386 (Comfort telephony) MODEL 207.3 up to 2/28/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) with CODE 386 (Comfort telephony) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 386 (Comfort telephony) (**) Carefully unclip mounting console (24). Otherwise the catch hooks (25) can break and the mounting console (24) must be replaced. **Yes a console of telephony of the mounting console (24) was the replaced. **Yes a console of telephony of the mounting console (24) must be replaced. **Yes a console of telephony of telep	*110589035900
25.3	Unclip connecting strip (41) with assembly wedge (23) and remove	MODEL 204.0/2 as of 3/1/11 with CODE 386 (Comfort telephony) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) with CODE 386 (Comfort telephony) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 386 (Comfort telephony) (3) Carefully unclip connecting strip (41). Otherwise the catch hooks can break and the connecting strip (41) must be replaced. 1 The catch hook on the connecting strip (41) is located at the same location as the catch hook (25) of the mounting console (39).	*110589035900
26	Unclip USB electrical connector (X115) from connector strip (41) and remove	MODEL 204 with CODE 512 (COMAND APS with DVD changer) MODEL 207.3 as of 6/1/12 up to model year 2014 with CODE 510 (Audio 20 CD with CD changer) MODEL 207.3 as of 6/1/12 up to model year 2014 with CODE 523 (MB Audio 20 radio) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 523 (MB Audio 20 radio) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 512 (COMAND APS with DVD changer) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 526 (COMAND with single DVD drive (without navigation)) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 527 (COMAND APS with single DVD drive (with navigation)) MODEL 207.3 as of 7/1/11 up to model year 2014 with CODE 528 (COMAND with DVD changer) MODEL 207.3 as of model year 2014 without CODE 427 (7G-TRONIC)	

		Model 207.3 as of model year 2014 Connector strip (41) eliminated. The USB electrical connector(X115) is directly clipped into the housing of center console (1)	
27	Remove mounting console (24) from center console (1) until flap (28) is accessible	MODEL 204.0/2 up to 2/28/11 with CODE 386 (Comfort telephony) MODEL 207.3 up to 2/28/11 up to model year 2014 with CODE 386 (Comfort telephony)	
		MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) with CODE 386 (Comfort telephony) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 386 (Comfort telephony)	
28	Open flap (28) and Remove bolt (29)	MODEL 204.0/2 up to 2/28/11 with CODE 386 (Comfort telephony) MODEL 207.3 up to 2/28/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 212.0 (except 212.074/077), 212.1,	
		212.2 (except 212.274/277) with CODE 386 (Comfort telephony) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 386 (Comfort telephony)	
29	Unclip cover (30) from Bluetooth module (A34/7)	MODEL 204 (except 204.9) with CODE 386 (Comfort telephony) MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony) without CODE 427 (7G-TRONIC) MODEL 207.3 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) with CODE 386 (Comfort telephony)	
		without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 386 (Comfort telephony)	
30.1	Guide Bluetooth module (A34/7) out mounting console (24)	MODEL 204.0/2 up to 2/28/11 with CODE 386 (Comfort telephony) MODEL 207.3 up to 2/28/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 212.0 (except 212.074/077), 212.1, 212.2 (except 212.274/277) with CODE 386 (Comfort telephony) without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277 with CODE 386 (Comfort telephony)	
30.2	Unscrew bolt (35) and remove Bluetooth module (A34/7) from mounting console (36)	MODEL 204.0/2 as of 3/1/11 with CODE 386 (Comfort telephony) MODEL 204.3 with CODE 386 (Comfort telephony) MODEL 204.9 with CODE 386 (Comfort telephony) MODEL 207.3 as of 3/1/11 up to model year 2014	
		with CODE 386 (Comfort telephony) MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony) without CODE 427 (7G-TRONIC)	
31	Remove Bluetooth module (A34/7) from mounting console (39)	MODEL 204.0/2 as of 3/1/11 with CODE 386 (Comfort telephony) MODEL 204.3 with CODE 386 (Comfort telephony) MODEL 204.9 with CODE 386 (Comfort telephony) MODEL 207.3 as of 3/1/11 up to model year 2014 with CODE 386 (Comfort telephony) MODEL 207.3 as of model year 2014 with CODE 386 (Comfort telephony) without CODE 427 (7G-TRONIC) MODEL 204.0/2 as of 3/1/11, 204.3 with CODE 386 (Comfort telephony)	AR82.70-P-8919EC

		MODEL 207.3 as of 3/1/11	AR82.70-P-8919ECA
		up to model year 2014	
		with CODE 386 (Comfort telephony)	
		MODEL 207.3	
		as of model year 2014	
		with CODE 386 (Comfort telephony)	
		without CODE 427 (7G-TRONIC)	
2.1	Disconnect electrical connector (31) and	MODEL 204.0/2 up to 2/28/11	
	remove Bluetooth module (A34/7) with	with CODE 386 (Comfort telephony)	
	associated electrical lines from center console	MODEL 207.3 up to 2/28/11	
	(1)	up to model year 2014	
		with CODE 386 (Comfort telephony)	
		MODEL 212.0 (except 212.074/077), 212.1,	
		212.2 (except 212.274/277)	
		without CODE 279 (Electronic gear selector) MODEL 212.074/077/274/277	
2.2	Disconnect electrical connector (38) and	MODEL 204.9	
2.2	remove Bluetooth module (A34/7) with	with CODE 386 (Comfort telephony)	
	associated electrical lines from center console	With GGBE GGG (GGIIIIGH telephony)	
	(1)		
3	Remove center console (1) from vehicle		
4	Remove rear blower motor from center	MODEL 204.0/2	
	console (1)	with CODE 581 (Automatic air conditioning)	
		MODEL 212.0 (except 212.074/077), 212.1,	
		212.2 (except 212.274/277)	
		with CODE 581 (Automatic air conditioning)	
		without CODE 279 (Electronic gear selector)	
		MODEL 212.074/077/274/277	
		with CODE 581 (Automatic air conditioning)	
			AR83.30-P-5565EW
5	Assemble in the reverse order		

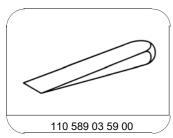

Mounting wedge