


MODEL 204.0/2/3, 207, 212


MODEL 218

Shown on model 204.0

- 1 Washer fluid reservoir
- 2 Expansion rivet (MODEL 204.0/2/3, 212)
- 3 Cover (MODEL 204.0/2/3, 212)
- 4 Screw
- 5 Bracket

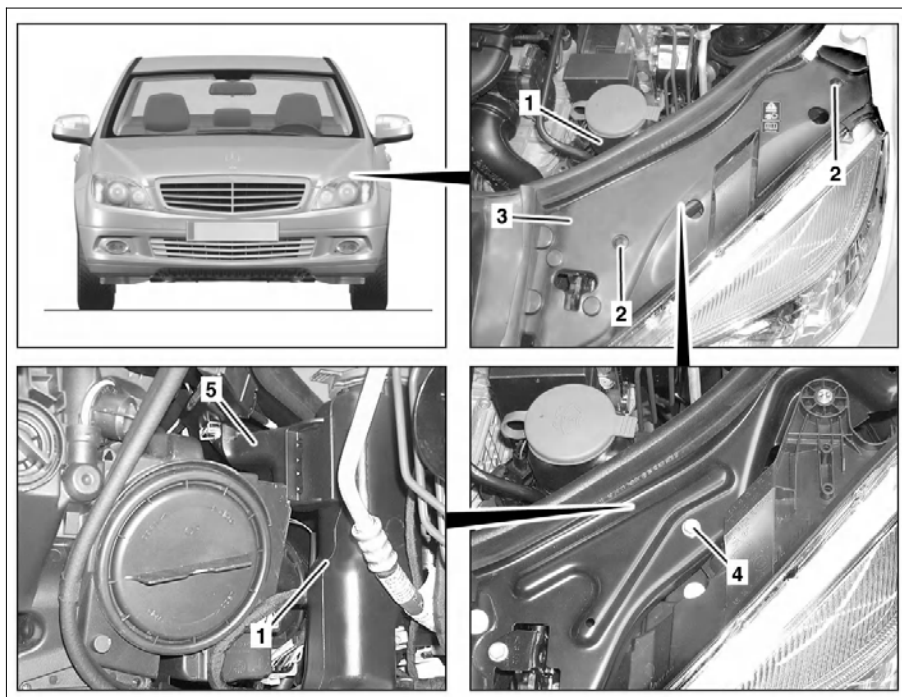

P82.35-2502-06

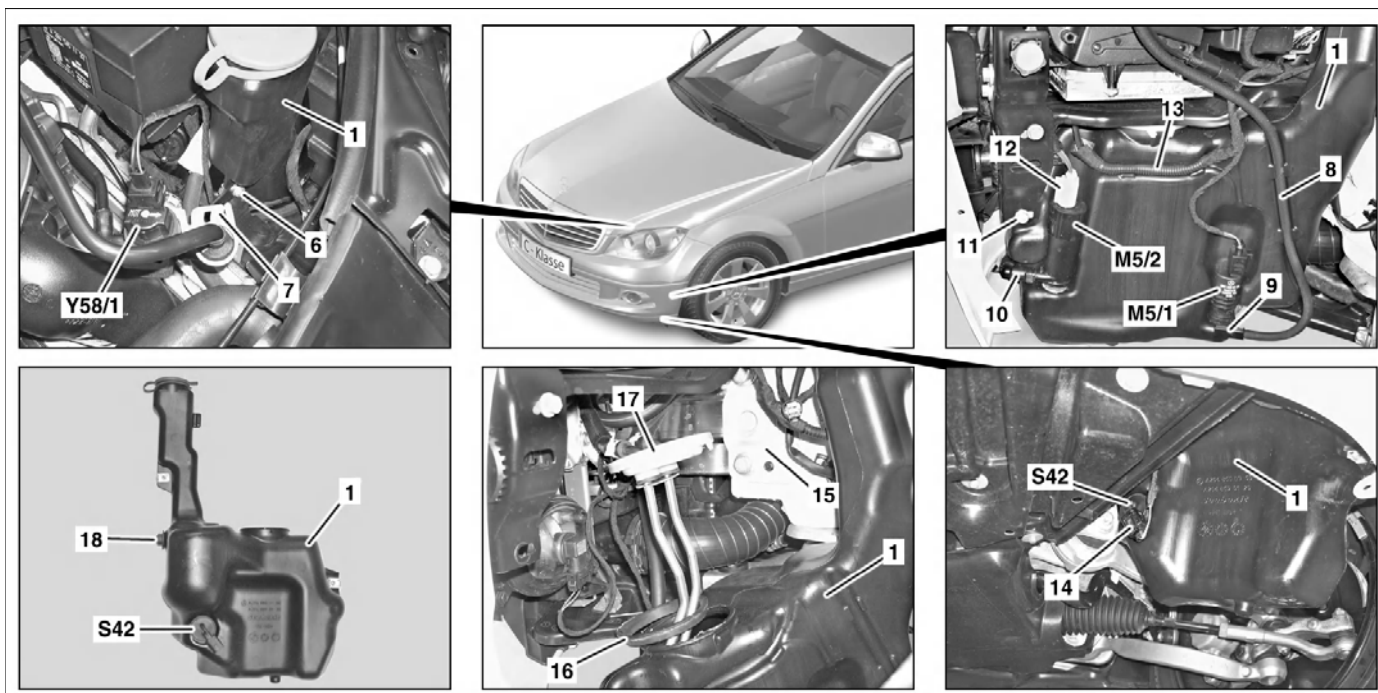











P82.35-2503-09


Shown on MODEL 204.0 with ENGINE 272 and with CODE 600 (Headlamp cleaning system) and with CODE 875 (Heated windshield washer system)

- | | | | |
|---|---|----|--|
| 1 | Washer fluid reservoir | 14 | Electrical connector |
| 6 | Screw | 15 | Bracket |
| 7 | Bracket (MODEL 204.0/2/3 with ENGINE 156, 271, 272, 274, 276, MODEL 207 with ENGINE 271, 272, 273, 274, 276, 278, MODEL 212 with ENGINE 156, 157, 271, 272, 273, 274, 276, 278, MODEL 218 with ENGINE 157, 274, 276, 278) | 16 | Seal (with CODE 875 (Heated windshield washer system)) |
| 8 | Washer fluid hose | 17 | Heat exchanger (with CODE 875 (Heated windshield washer system)) |

9	Hose connector	18	Pin
10	Hose coupling (MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system), MODEL 218 up to model year 2015)	M5/1	Windshield washer system pump
11	Screw	M5/2	Headlamp cleaning system pump (MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system), MODEL 218 up to model year 2015)
12	Electrical connector (MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system), MODEL 218 up to model year 2015)	S42	Windshield washer system fluid level switch
13	Wiring harness (MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system), MODEL 218 up to model year 2015)	Y58/1	Purge switchover valve (MODEL 204.0/2/3 with ENGINE 156, 271, 272, 274, 276, MODEL 207 with ENGINE 271, 272, 273, 274, 276, 278, MODEL 212 with ENGINE 156, 157, 271, 272, 273, 274, 276, 278, MODEL 218 with ENGINE 157, 274, 276, 278)

	Remove/install		
1	Remove expansion rivet (2) and remove cover (3)	MODEL 204.0/2/3, 212	
2	Remove screw/bolt (4) and unclip bracket (5) from washer fluid reservoir (1)		
3	Unhook purge switchover valve (Y58/1) from bracket (7)	MODEL 204.0/2/3 with ENGINE 156, 271, 272, 274, 276 MODEL 207 with ENGINE 271, 272, 273, 274, 276, 278 MODEL 212 with ENGINE 156, 157, 271, 272, 273, 274, 276, 278 MODEL 218 with ENGINE 157, 274, 276, 278	
4	Remove bolt (6)		
	Risk of death caused by vehicle slipping or toppling off of the lifting platform.	Align vehicle between vehicle lift columns and position the four support plates at the vehicle lift support points specified by the vehicle manufacturer.	AS00.00-Z-0010-01A
5	Lift vehicle on vehicle lift		
6	Remove fender liner front section in left front fender	MODEL 204.0/2/3, 207, 212 MODEL 218 MODEL 207, 212, 218	AR88.10-P-1300ELX
7	Unclip washer fluid hose (8) from washer fluid reservoir (1)		
8	Unclip windshield washer system pump (M5/1) and place to one side with lines connected	 Collect washer fluid which flows out.  Mounting wedge	*110589035900
9	Detach hose coupling (10)	MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system) MODEL 218 up to model year 2015	
10	Disconnect electrical connector (12) and expose wiring harness (13)	MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system) MODEL 218 up to model year 2015	
11	Unclip headlamp cleaning system pump (M5/2) and remove	MODEL 204.0/2/3, 207, 212 with CODE 600 (Headlamp cleaning system) MODEL 218 up to model year 2015  Mounting wedge	*110589035900
12	Remove bolt (11)		
13	Lower washer fluid reservoir (1)	 Installation: Insert pin (18) of washer fluid reservoir (1) into bracket (15).	
14	Detach electrical connector (14) from windshield washer system fluid level switch (S42)		
15	Unclip heat exchanger (17) from washer fluid reservoir (1) and guide heat exchanger (17) out of washer fluid reservoir (1)	MODEL 204.0/2/3, 207, 212 with CODE 875 (Heated windscreen washer system) MODEL 218 with CODE 875 (Heated windscreen washer system)  Installation: Ensure that seal (16) is seated correctly.  Mounting wedge	*110589035900
16	Take off washer fluid reservoir (1)		
17	Remove windshield washer system fluid level switch (S42)	When replacing the washer fluid reservoir (1).  Mounting wedge	*110589035900
18	Install in the reverse order		

19  AP  AP	Fill washer fluid reservoir (1)	MODEL 204.0/2/3 MODEL 207, 212 MODEL 218	AP82.35-P-8210CW AP82.35-P-8210EW
---	---------------------------------	--	--------------------------------------

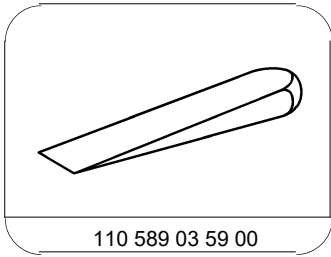

110 589 03 59 00

Mounting wedge