
Model 205 Model 213, 238 Model 253 Model 293





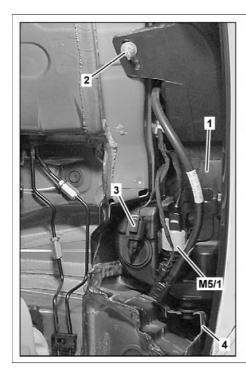

P82.35-2755-09

## Shown on model 205 with code 875 (Heated windshield washer system)

- 1 Washer fluid reservoir 5 Filler neck
- 2 Nut 6 Heat exchanger (with CODE 875 (Heated windshield
  - washer system))
- 3 Electrical connector M5/1 Windshield washer system pump 4 Guide

	Risk of fire and explosion caused by ignition of window washing fluid or antifreeze and their vapors. Risk of poisoning caused by swallowing window washing fluid or antifreeze or inhaling their vapors. Risk of injury or physical irritations caused by contact of window washing fluid or antifreeze with eyes, mucous membranes or skin.	Wear protective clothing and tight-fitting safety glasses. No open flames, fire or ignition sources. Avoid contact with eyes, mucous membranes and skin. When working with window washing fluids or antifreeze, do not eat, drink, or smoke. Do not inhale vapors and ensure sufficient ventilation in the working area. Store window washing fluid and antifreeze leakfree in safely closed original containers and out of the reach of children.	
XX	Remove/install		
1	Remove left front wheel.		AR40.10-P-1102A
2	Remove fender liner (rear section) in left front fender.	Model 205, 253, 293	AR88.10-P-1300LW
		Model 213, 238	AR88.10-P-1300LWE
3	Unbolt nut (2).		
4	Remove windshield washer system pump (M5/1) and place to one side with connected lines.	i Collect escaping washer fluid in a suitable vessel.	
5	Disconnect electrical connector (3).		
6	Remove washer fluid reservoir (1) upwards from guide (4).		
7	Detach washer fluid reservoir (1) from filler neck (5).	Installation: Ensure that filler neck (5) is seated correctly at washer fluid reservoir (1). Leaks can occur otherwise.	

8	Remove heat exchanger (6).	Model 205, 213, 238, 253 with code 875 (Heated windscreen washer system)  i Do not disconnect refrigerant hoses.	AR82.35-P-6006LW
9	Remove washer fluid reservoir (1).		
10	Install in the reverse order		
11	Correct fluid level of windshield washer system.		
FAP		Model 293	AP82.35-P-8210H
₩ŶΑP		Model 205	AP82.35-P-8210CAA
<b>⊯</b> AP		Model 213, 238, 253	AP82.35-P-8210C